Boyce Evens & Carpenter,		
Chartered Surveyors,		al.
10 Genotin Terrace,	Date	15 th September 2014
Enfield,		
Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 1 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 21, renew the existing timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm.	£95.00
2.	To Window 21, carry out 150mm length splice repair to base of right hand pulley stile using Repair Care repair method C4.	£45.00
3.	To Window 21, remove decayed timber from base of external lining to right hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
4.	To Window 22, renew the existing timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm approx.	£95.00
5.	To Window 22, remove decayed timber from base of right hand pulley stile and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm³ in volume.	£25.00
6.	To Window 22, remove decayed timber from base of external lining to right hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
7.	To Window 23, carry out conservation joint repair to left hand end of bottom rail to top sash using Repair Care repair method P2.	£25.00
8.	To Window 23, remove decayed timber from right hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
9.	To Window 23, remove decayed timber from base of external lining to right hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
10.	To Window 24, renew the existing timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm approx.	£95.00

11.	To Window 24, remove decayed timber from base of right hand pulley stile and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
12.	To Window 25, renew the existing timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm approx.	£95.00
13.	To Window 25, remove decayed timber from base of right hand perimeter architrave and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
	Sub Total	£625.00
	VAT @ 20%	£125.00
	TOTAL	£750.00

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Mrs Michelle Hillgarth c/o Paul Brown-Constable MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

RECEIPT / INVOICE 4036

VAT REG NO. 652 8482 15

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REI	F: ADW/	4474/LW	
RE	CEIPT & TAX	INVOICE	7.				
ILL	CEII I & IIIX	III V OICI	2				
MITI	RE HOUSE, 124 KINGS	ROAD, LOND	OON SW3	•			
					*0		
To	Front Elevation Windo	w Repairs to FI	LAT 5			445	00
	Value Added Tax @	20%				89	00
	value ridded rax (a)	2070					
					£	534	00

PAYMENT RECEIVED WITH THANKS

A.R. LAWRENCE & SONS LTD

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Diego Fortunati c/o Paul Brown-Constable MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

RECEIPT / INVOICE 4035

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: ADW	/4474/LW 	
REC	CEIPT & TAX	NVOICE	1			
MITR	E HOUSE, 124 KINGS	ROAD, LOND	ON SW3			
То	Front Elevation Window	v Repairs to FL	AT 9		365	00
	Value Added Tax @ 2	0%			73	00
				£	438	00
	MENT RECEI	VED WI	TH THANKS	'eec'		

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Chelsea & Belgravia Investments Ltd c/o
Paul Brown-Constable
MITRE HOUSE MANAGEMENT LTD
7 MITRE HOUSE
124 KINGS ROAD
LONDON
SW3 4TP

RECEIPT / INVOICE 4034

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: A	DW/4474/LW	1
	E HOUSE, 124 KINGS					
То	Front Elevation Window	w Repairs to FL	AT 8		195	00
	Value Added Tax @ 2	0%			39	00
					£ 234	00
	MENT RECEI	IVED WI	TH THANKS		wer	

BUILDERS & DECORATORS

72 PINE WALK **CARSHALTON BEECHES SURREY** SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com Dr S F Riad EL Gharb Paul Brown-Constable

MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

c/o

RECEIPT / INVOICE 4033

VAT REG NO. 652 8482 15

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: ADW/-	4474/LW	
RE(CEIPT & TAX	INVOICE	2			
			and the second			
MITR	E HOUSE, 124 KINGS	ROAD, LOND	ON SW3			
То	Front Elevation Windo	w Repairs to FL	LAT 4		595	00
	Value Added Tax @	20%			_119	00
				£	714	00

PAYMENT RECEIVED WITH THANKS

A.R. LAWRENCE & SONS LTD

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Mr & Mrs E Leoni-Sceti c/o Paul Brown-Constable MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

RECEIPT / INVOICE 4032

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: ADW	/ <u>4474/LW</u>	
	E HOUSE, 124 KINGS					
То	Front Elevation Window	w Repairs to FL	AT 3		90	00
	Value Added Tax @ 2	0%			18_	00
				£	108	00
	MENT RECEI	VED WI	TH THANKS	" com		

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Mr Segar Karupiah c/o Paul Brown-Constable MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

RECEIPT / INVOICE 4031

VAT REG NO. 652 8482 15

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: ADW/4	1474/LW	
RE	CEIPT & TAX	INVOICE	\mathbf{E}			
MIT	RE HOUSE, 124 KING.	S ROAD, LONL	OON SW3			
То	Front Elevation Wind	ow Repairs to FI	LAT 2		345	0
	Value Added Tax @	20%			69	0
				£	414	0

PAYMENT RECEIVED WITH THANKS

A.R. LAWRENCE & SONS LTD

BUILDERS & DECORATORS

72 PINE WALK CARSHALTON BEECHES SURREY SM5 4HD

Tel/Fax: 020 8642 3101 Tel/Fax: 020 8643 3482

E-mail: arlawrencemail@aol.com

Paul Brown-Constable MITRE HOUSE MANAGEMENT LTD 7 MITRE HOUSE 124 KINGS ROAD LONDON SW3 4TP

RECEIPT / INVOICE 4030

DATE	8 OCTOBER 2014	YOUR REF	DEREK ISAACS	OUR REF: ADW	/4474/LW 	
	CEIPT & TAX					
MITR	E HOUSE, 124 KINGS	ROAD, LOND	ON SW3			
То	Front Elevation Window	w Repairs to FL	AT 1		625	00
	Value Added Tax @ 2	0%			_125	00
				£	750	00
PAY	MENT RECEI	IVED WI	TH THANKS			

Boyce Evens & Carpenter, Chartered Surveyors,		
10 Genotin Terrace,	Date	15 th September 2014
Enfield, Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 2 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 26, remove decayed timber from both ends of bottom rail to bottom sash and carry out two pack filler repairs using Repair Care repair method C1, each repair size < 50 cm ³ in volume.	£50.00
2.	To Window 26, renew the existing timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm approx.	£95.00
3.	To Window 26, carry out 200mm length splice repair to base of external lining to right hand box frame jamb using Repair Care repair method C4.	£65.00
4.	To Window 26, remove decayed timber from base of external lining to left hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
5.	To Window 77, replace 1 No. cracked pane glass to top sash with clear sheet glass, size 260 x 330mm approx.	£55.00
6.	To Window 77, refix/re-pin the loose right hand architrave.	£5.00
7.	To Window 77, remove decayed timber from right hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 m³ in volume.	£25.00
8.	To Window 77, remove decayed timber from base of external lining to left hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 m³ in volume.	£25.00
	Sub Total	£345.00
	VAT @ 20%	£69.00
	TOTAL	£414.00

Boyce Evens & Carpenter, Chartered Surveyors, 10 Genotin Terrace, Enfield,	Date	15 th September 2014
Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 3 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 19, insert timber filler piece/splice to cut out in head around base of keystone using Repair Care repair method C4, length 150mm approx.	£45.00
2.	To Window 20, insert timber filler piece/splice to cut out in head around base of keystone using Repair Care repair method C4, length 150mm approx.	£45.00
	Sub Total	£90.00
	VAT @ 20%	£18.00
	TOTAL	£108.00

Boyce Evens & Carpenter, Chartered Surveyors,		
10 Genotin Terrace,	Date	15 th September 2014
Enfield, Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 4 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 12, remove decayed timber from right hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm³ in volume.	£25.00
2.	To Window 12, remove decayed timber from base of external lining to left hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
3.	To Window 13, remove decayed timber from right hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
4.	To Window 14, remove decayed timber from both ends of cill and carry out two pack filler repairs using Repair Care repair method C1, each repair size < 50 cm ³ in volume.	£50.00
5.	To Window 14, carry out 150mm length splice repair to base of external lining to right hand box frame jamb using Repair Care repair method C4.	£45.00
6.	To Window 15, carry out conservation joint repair to right hand end of bottom rail to bottom sash using Repair Care repair method P2.	£25.00
7.	To Window 15, renew the timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm.	£95.00
8.	To Window 15, remove decayed timber from retained back part of cill and carry out two pack filler repair using Repair Care repair method C1, repair size 50-100 cm ³ in volume.	£45.00
9.	To Window 15, carry out 200mm length splice repair to base of left hand pulley stile using Repair Care repair method C4.	£65.00
10.	To Window 15, carry out 200mm length splice repair to base of right hand pulley stile using Repair Care repair method C4.	£65.00
11.	To Window 15, carry out 200mm length splice repair to base of external lining to left hand box frame jamb using Repair Care repair method C1.	£65.00

12.	To Window 15, carry out 200mm length splice repair to base of external lining to right hand box frame jamb using Repair Care repair method C1.	£65.00
	Sub Total	£595.00
	VAT @ 20%	£119.00
	TOTAL	£714.00

Boyce Evens & Carpenter,		
Chartered Surveyors, 10 Genotin Terrace,	Date	15 th September 2014
Enfield,		-
Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 5 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 10, carry out conservation joint repair to left hand end of bottom rail to bottom sash using Repair Care repair method P2.	£25.00
2.	To Window 10, renew the timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm.	£95.00
3.	To Window 10, carry out 200mm length splice repair to base of right hand pulley stile using Repair Care repair method C4.	£65.00
4.	To Window 10, carry out 3000mm length splice repair to base of external lining to right hand box frame jamb using Repair Care repair method C4.	£75.00
5.	To Window 10, carry out 200mm length splice repair to base of external lining to left hand box frame jamb using Repair Care repair method C4.	£65.00
6.	To Window 11, renew the timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm.	£95.00
7.	To Window 11, remove decayed timber from base of right hand pulley stile and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
	Sub Total	£445.00
	VAT @ 20%	£89.00
	TOTAL	£534.00

Boyce Evens & Carpenter,		
Chartered Surveyors,		
10 Genotin Terrace,	Date	15 th September 2014
Enfield,		
Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 8 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 1, carry out conservation joint repairs to both ends of bottom rail to bottom sash using Repair Care repair method P2.	£50.00
2.	To Window 1, remove decayed timber from left hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
3.	To Window 1, remove decayed timber from right hand end of cill and carry out two pack filler repair using Repair Care repair method C1, repair size 50-100 cm³ in volume.	£25.00
4.	To Window 2, carry out conservation joint repairs to both ends of bottom rail to bottom sash using Repair Care repair method P2.	£50.00
5.	To Window 2, remove decayed timber from both ends of cill and carry out two	
	pack filler repairs using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
	Sub Total	£195.00
	VAT @ 20%	£39.00
	TOTAL	£234.00

Boyce Evens & Carpenter, Chartered Surveyors, 10 Genotin Terrace,	Date	15 th September 2014
Enfield, Middx EN1 2AF.	Job No.	D3827
Tel: 020 8367 5100		

FLAT 9 – SCHEDULE OF WINDOW REPAIRS

1.	To Window 8, carry out conservation joint type repair to split right hand end of bottom rail to top sash using Repair Care repair method P2.	£25.00
2.	To Window 8, remove decayed timber from both ends of cill and carry out two pack filler repairs using Repair Care repair method C1, each repair size < 50 cm ³ in volume.	£50.00
3.	To Window 9, renew the timber cill with new hardwood cill to match using Repair Care repair method C2, length 850mm.	£95.00
4.	To Window 9, carry out conservation joint repairs to both ends of bottom rail to top sash using Repair Care repair method P2.	£50.00
5.	To Window 9, carry out conservation joint repairs to both ends of bottom rail to bottom sash using Repair Care repair method P2.	£50.00
6.	To Window 9, remove decayed timber from retained rear part of cill at right hand end and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
7.	To Window 9, carry out 150mm length splice repair to base of right hand pulley stile using Repair Care repair method C4.	£45.00
8.	To Window 9, remove decayed timber from base of external lining to right hand box frame jamb and carry out two pack filler repair using Repair Care repair method C1, repair size < 50 cm ³ in volume.	£25.00
	Sub Total	£365.00
	VAT @ 20%	£73.00
	TOTAL	£438.00