

Connecticut Lead Paint Solutions, LLC

1245 Hebron Avenue
Glastonbury, CT 06033
860-633-3330
CT License #2124
andrew@ctleadpaint.com

Lead Paint Inspections & Testing
Consulting & Cost Analysis
Abatement/Management Plans
Abatement & Clean-up

Lead Paint Inspection Report

Andrew Miller, Inspector
Connecticut Lead Consultant and Contractor License #002124
Connecticut Lead Inspector/Risk Assessor #002179

This report is prepared for;
Mr. and Mrs. Anyone
100 Main St
Anytown, CT 06000

The property inspected was;
100 Main St
Anytown, CT 06000

The testing instrument used is a Niton XLP 300A Lead Paint, Spectrum Analyzer, serial #16387. A reading of 1.0 milligrams lead per square centimeter of surface ($1.0\text{mg}/\text{cm}^2$) or greater is defined as a toxic level of lead, by the State of Connecticut, Dept. of Public Health, Regulations for Lead Poisoning Prevention and Control, 19a-111-1a. The inspection protocol as detailed in Chapter 7 of the HUD Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing (2012 Revision) was used for this inspection. The testing mode is K+L Spectrum.

At the beginning and end of the inspection, calibration tests are done on known control standards and the readings recorded to ensure the accuracy of the testing device. The calibration lines on the data sheets provides the measured lead concentration of the control standards (in the Condition Column) and whether the lead is at the surface or buried under non-leaded paint.

The testing protocol is to test representative samples of various building components or sub-components per room or area. The test result for the representative sample is then applied to the other similar component(s) in that room or area. Refer to the floor plan attach toward the end of this report for the location of the rooms and walls sides (A, B, C, D).

Any lead reading $1.0\text{mg}/\text{cm}^2$ or greater is positive for toxic levels of lead and the line for that reading is in **red print** on the data sheets.

This inspection is for lead in paint primarily. Water samples were collected for analysis of lead concentrations. The test results are pending.

The inspection was done on July 05, 2016.

The property inspected was a large single family house built in 1783. All livable rooms or areas in the house were inspected. The Basement Stairs, the unfinished basement and the Attic were not inspected.

Each room or area had some readings that were positive for lead-based paint (LBP). Most, but not all, of the test readings on the plaster or drywall walls or ceilings were negative for LBP. Many, but not all, of the interior positive surfaces detected were intact.

The wood window sashes (the part of the window which contains the glass and is movable) in Rooms #1 and 2, #6 and 7 and the Hall are newer sashes in existing openings. The window wells and blind stops in these existing opening should be assumed positive for LBP. There are new construction windows in Room #5 and vinyl window units in Room #10. The exterior of the new wood window sashes are all assumed to be negative for LBP.

The exterior of the house is constructed with unpainted brick with wood upper trim and window casings. Some of the exterior surfaces tested were positive for LBP.

All of the test results are detailed on the data sheets for the inspection.

If you have any questions on this report, please do not hesitate to contact me.

Andrew Miller
Lead Inspector/Risk Assessor, CT #002179
July 08, 2016

How to read the data sheets

Starting from the left side column.

Index	The instrument assigns a number to every reading.
Fl.	Floor level
Room	Indicated which room or area was tested. The room or area is also detailed on the floor plan.
Side	The side of the room that faces the street is the A Side, the B side is clockwise to the A wall, the C wall is opposite the A wall and so on. For the exterior the A side is the front facing the street, the B side is clockwise, the C side is the rear ect. See attached floor plan for more details.
Component	Indicates which building component was tested, window, door, wall ect. Many components have sub-components such as a window <i>casing</i> or window <i>sash</i> . If there is more than 1 similar building component on a wall in a room or area, than the component may be further described as being the Lft for left, Ctr for center or Rht for right. This would be as you face the wall.
Substrate	Indicates what building material the component was constructed of. Not always accurate for drywall or plaster walls.
Color	Indicates the color of the test surface. The color selected is influenced by many factors including lighting, contrasting colors, smoke films and others.
Condition	Indicates the condition of the paint film or the substrate. The ratings are as follows; Intact, a paint film with no cracked or peeling paint; Fair, the paint film is cracked or chipped but paint chips can not be picked off; Poor, the paint film is cracked or chipped and paint chips can be picked off; Peeling; the paint film is very loose and can fall off with little or no external effort; Defective-Sub, defective substrate. The worse visible condition is noted. Substrate conditions are only listed if it affects the condition of the paint film.
Result	Indicates the results of that test. Either Positive, equal to or greater than 1.0 milligrams lead per square centimeter of surface ($1.0\text{mg}/\text{cm}^2$) Negative meaning below the action level of $1.0\text{mg}/\text{cm}^2$ or Null if the reading was interrupted and not completed. The incomplete reading is almost always followed by a complete reading from the same surface. All positive reading lines are in color print.
PbC	This is the range of the lead concentration in the dry paint. The testing instrument narrows the reading down to plus or minus from the main (1 st) number.

On the data sheets any lead reading $1.0\text{mg}/\text{cm}^2$ or greater is positive for lead-based paint and the line for that reading is in color print. The calibration readings are from the known control standards and not from any painted surface on the property tested. Even a property that has been certified as being “free of lead-based paint” will still have positive calibration readings listed on the report.

Connecticut Lead Paint Solutions, LLC
 1245 Hebron Ave
 Glastonbury, CT 06033
 860-633-3330 Since 1994

100 Main St, Anytown, CT 06000

February 01, 2018

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
1				Calibration- Surface			1.53mg/cm ²	Positive	1.60 ± 0.40
2				Calibration- Surface			1.04mg/cm ²	Positive	1.10 ± 0.10
3				Calibration- Surface			1.04mg/cm ²	Positive	1.10 ± 0.10
4				Calibration- Surface			1.04mg/cm ²	Positive	1.10 ± 0.10
5				Calibration- Surface			0.01mg/cm ²	Negative	0.00 ± 0.02
6	1st	Room 1	A	Window Sill Lft	Wood	Green	Intact	Positive	2.20 ± 1.10
7	1st	Room 1	A	Window Casing	Wood	Green	Intact	Positive	2.90 ± 1.60
8	1st	Room 1	A	Window Jamb	Wood	Green	Intact	Positive	3.70 ± 2.10
9	1st	Room 1	A	Window Sash Int.	Wood	Green	Intact	Negative	0.00 ± 0.02
10	1st	Room 1	B	Door	Wood	Green	Intact	Positive	5.60 ± 3.40
11	1st	Room 1	B	Door Jamb	Wood	Green	Intact	Negative	0.06 ± 0.12
12	1st	Room 1	B	Door Casing	Wood	Green	Intact	Negative	0.50 ± 0.30
13	1st	Room 1	C	Fireplace Mantel	Wood	Green	Intact	Positive	1.40 ± 0.40
14	1st	Room 1	C	Fireplace Trim	Wood	Green	Intact	Positive	1.50 ± 0.40
15	1st	Room 1	C	Fireplace Hearth	Brick	Red	Intact	Positive	3.90 ± 2.40
16	1st	Room 1	C	Fireplace Hearth	Brick	Red	Intact	Positive	2.80 ± 1.70
17	1st	Room 1	D	Baseboard	Wood	Green	Intact	Positive	2.20 ± 0.60
18	1st	Room 1	D	Radiator	Metal	Silver	Intact	Negative	0.05 ± 0.20
19	1st	Room 1	D	Cabinet Door Rht	Wood	Green	Intact	Negative	0.70 ± 0.30
20	1st	Room 1	D	Cabinet Door Rht	Wood	Green	Intact	Negative	0.19 ± 0.23
21	1st	Room 1	D	Cabinet Frame	Wood	Green	Intact	Negative	0.40 ± 0.30
22	1st	Room 1	D	Cabinet Shelf	Wood	Green	Intact	Positive	12.50 ± 9.70
23	1st	Room 1	D	Cabinet Wall	Wood	Green	Intact	Positive	25.20 ± 14.80
24	1st	Room 1	D	Cabinet Wall	Wood	Green	Intact	Positive	25.00 ± 18.50
25	1st	Room 1	A	Wall	Plaster	White	Intact	Negative	0.02 ± 0.07
27	1st	Room 1	B	Wall	Plaster	White	Intact	Negative	0.01 ± 0.03
28	1st	Room 1	C	Wall	Plaster	White	Intact	Negative	0.19 ± 0.15
29	1st	Room 1	D	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
31	1st	Room 1	A	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
32	1st	Room 1	B	Ceiling Trim	Wood	White	Intact	Positive	1.70 ± 0.50
33	1st	Room 1	B	Floor	Wood	Brown	Intact	Negative	0.04 ± 0.06
34	1st	Room 2	A	Window Sill Rht	Wood	Red	Intact	Positive	6.20 ± 3.70
35	1st	Room 2	A	Window Casing	Wood	Red	Intact	Positive	7.60 ± 5.90
36	1st	Room 2	A	Window Jamb	Wood	Red	Intact	Positive	3.70 ± 1.70
37	1st	Room 2	A	Window Sash Int.	Wood	Red	Intact	Negative	0.00 ± 0.02
38	1st	Room 2	A	Window Sash Ext.	Wood	White	Intact	Negative	0.01 ± 0.03
39	1st	Room 2	A	Window Well	Wood	White	Poor	Positive	7.50 ± 5.90
40	1st	Room 2	D	Door	Wood	Red	Intact	Positive	1.90 ± 0.70
41	1st	Room 2	D	Door Casing	Wood	Red	Poor	Positive	12.10 ± 10.10
42	1st	Room 2	C	Opening Jamb	Wood	Red	Intact	Positive	30.90 ± 19.00
43	1st	Room 2	C	Closet Door	Wood	Red	Intact	Positive	2.40 ± 1.20
44	1st	Room 2	C	Closet Casing	Wood	Red	Poor	Positive	4.70 ± 3.40
45	1st	Room 2	C	Closet Shelf	Wood	White	Intact	Positive	5.50 ± 3.30
46	1st	Room 2	C	Closet Wall	Wood	White	Intact	Positive	10.10 ± 8.80
47	1st	Room 2	C	Closet Floor	Wood	White	Intact	Positive	24.40 ± 18.20
48	1st	Room 2	C	Fireplace Mantel	Wood	Red	Intact	Positive	19.80 ± 14.20
49	1st	Room 2	C	Fireplace Trim	Wood	Red	Intact	Positive	11.30 ± 9.10
50	1st	Room 2	C	Fireplace Hearth	Wood	Red	Intact	Positive	1.70 ± 0.60
51	1st	Room 2	C	Fireplace Hearth	Wood	Red	Intact	Negative	0.50 ± 0.10

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
52	1st	Room 2	B	Bookcase Frame Rht	Wood	Brown	Intact	Negative	0.01 ± 0.04
53	1st	Room 2	B	Bookcase Shelf	Wood	Brown	Intact	Negative	0.05 ± 0.14
54	1st	Room 2	B	Bookcase Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
55	1st	Room 2	A	Baseboard	Wood	Red	Intact	Positive	1.70 ± 0.60
56	1st	Room 2	B	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
58	1st	Room 2	A	Wall	Plaster	Wallpaper	Intact	Null	0.30 ± 0.15
59	1st	Room 2	C	Wall	Plaster	Wallpaper	Intact	Negative	0.00 ± 0.02
60	1st	Room 2	B	Wall	Plaster	Wallpaper	Intact	Negative	0.01 ± 0.03
61	1st	Room 2	D	Wall	Plaster	Wallpaper	Intact	Negative	0.00 ± 0.02
62	1st	Room 2	C	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
63	1st	Room 2	C	Floor	Wood	Brown	Intact	Positive	4.20 ± 2.80
64	1st	Room 2	D	Floor	Wood	Brown	Intact	Positive	6.50 ± 5.00
65	1st	Room 2 Hall	C	Door	Wood	White	Intact	Negative	0.09 ± 0.12
66	1st	Room 2 Hall	C	Door Jamb	Wood	White	Intact	Negative	0.04 ± 0.07
68	1st	Room 2 Hall	C	Door Header	Wood	White	Intact	Positive	7.00 ± 4.00
69	1st	Room 2 Hall	D	Baseboard	Wood	Red	Intact	Positive	2.50 ± 1.50
71	1st	Room 2 Hall	B	Wall	Wood	White	Intact	Positive	4.60 ± 3.30
72	1st	Room 2 Hall	D	Wall	Wood	White	Intact	Positive	3.00 ± 1.50
73	1st	Room 2 Hall	C	Ceiling	Drywall	White	Intact	Negative	0.00 ± 0.02
74	1st	Room 2 Hall	C	Floor	Wood	Brown	Intact	Null	0.80 ± 0.20
75	1st	Room 2 Hall	C	Floor	Wood	Brown	Intact	Positive	14.10 ± 10.90
76	1st	Foyer	A	Door	Wood	Blue	Intact	Positive	3.70 ± 2.10
77	1st	Foyer	A	Door Casing	Wood	Blue	Intact	Positive	4.40 ± 2.50
78	1st	Foyer	A	Door Jamb	Wood	Blue	Fair	Positive	1.70 ± 0.60
79	1st	Foyer	A	Door Side Lite	Wood	Blue	Intact	Positive	5.40 ± 3.50
80	1st	Foyer	B	Door Lft	Wood	Blue	Intact	Positive	29.30 ± 20.80
81	1st	Foyer	B	Door Casing	Wood	Blue	Intact	Positive	5.90 ± 3.50
82	1st	Foyer	C	Door	Wood	Blue	Intact	Negative	0.30 ± 0.20
83	1st	Foyer	C	Door Jamb	Wood	Blue	Intact	Positive	4.10 ± 2.50
84	1st	Foyer	D	Baseboard	Wood	Blue	Intact	Positive	3.00 ± 1.90
85	1st	Foyer	D	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
86	1st	Foyer	B	Stair Stringer	Wood	Blue	Intact	Positive	4.70 ± 3.00
87	1st	Foyer	A	Wall	Plaster	Wallpaper	Intact	Negative	0.01 ± 0.04
88	1st	Foyer	B	Wall	Plaster	Wallpaper	Intact	Negative	0.00 ± 0.02
89	1st	Foyer	C	Wall	Plaster	Wallpaper	Intact	Negative	0.00 ± 0.02
90	1st	Foyer	D	Wall	Plaster	Wallpaper	Intact	Negative	0.00 ± 0.02
91	1st	Foyer	Cr	Ceiling	Plaster	White	Peeling	Negative	0.00 ± 0.02
92	1st	Foyer	C	Floor	Wood	Brown	Intact	Negative	0.03 ± 0.06
93	1st	Foyer	A	Pipe	Metal	White	Peeling	Negative	0.01 ± 0.04
94	1st	Bath 1	C	Window Sill	Wood	White	Intact	Positive	1.80 ± 0.70
95	1st	Bath 1	C	Window Casing	Wood	White	Intact	Negative	0.09 ± 0.23
96	1st	Bath 1	C	Window Casing Outer	Wood	White	Intact	Negative	0.15 ± 0.18
97	1st	Bath 1	C	Window Sash Int.	Wood	White	Intact	Positive	6.00 ± 3.70
98	1st	Bath 1	A	Door	Wood	White	Intact	Negative	0.23 ± 0.19
99	1st	Bath 1	A	Door Casing	Wood	White	Intact	Negative	0.80 ± 0.20
100	1st	Bath 1	D	Baseboard	Wood	White	Intact	Positive	3.30 ± 2.00
101	1st	Bath 1	C	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
102	1st	Bath 1	B	Tub Ext.	Metal	White	Intact	Negative	0.30 ± 0.17
103	1st	Bath 1	A	Cabinet Door	Wood	Brown	Intact	Negative	0.00 ± 0.02

Connecticut Lead Paint Solutions, LLC
 1245 Hebron Ave
 Glastonbury, CT 06033
 860-633-3330 Since 1994

100 Main St, Anytown, CT 06000

February 01, 2018

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
104	1st	Bath 1	A	Chair Rail	Wood	White	Intact	Negative	0.01 ± 0.04
105	1st	Bath 1	A	Cabinet Frame Upr	Wood	Brown	Intact	Negative	0.00 ± 0.02
106	1st	Bath 1	A	Wall - Lower	Drywall	Wallpaper	Intact	Negative	0.01 ± 0.03
107	1st	Bath 1	B	Wall - Lower	Drywall	Wallpaper	Intact	Negative	0.21 ± 0.15
109	1st	Bath 1	C	Wall - Lower	Plaster	Wallpaper	Intact	Negative	0.10 ± 0.09
110	1st	Bath 1	D	Wall - Lower	Plaster	Wallpaper	Intact	Negative	0.10 ± 0.08
111	1st	Bath 1	A	Wall - Upper	Drywall	Wallpaper	Intact	Negative	0.02 ± 0.05
112	1st	Bath 1	B	Wall - Upper	Drywall	Wallpaper	Intact	Null	0.70 ± 0.10
113	1st	Bath 1	C	Wall - Upper	Plaster	Wallpaper	Intact	Negative	0.02 ± 0.02
114	1st	Bath 1	D	Wall - Upper	Plaster	Wallpaper	Intact	Negative	0.02 ± 0.04
115	1st	Bath 1	A	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
116	1st	Room 3	D	Window Sill	Wood	Green	Intact	Positive	2.20 ± 1.10
117	1st	Room 3	D	Window Casing	Wood	Green	Intact	Positive	1.40 ± 0.40
118	1st	Room 3	D	Window Sash Int.	Wood	Green	Intact	Negative	0.50 ± 0.20
119	1st	Room 3	D	Window Sash Int.	Wood	Green	Intact	Positive	8.70 ± 4.10
120	1st	Room 3	B	Door	Wood	Blue	Intact	Negative	0.14 ± 0.15
121	1st	Room 3	B	Door Casing	Wood	Blue	Intact	Negative	0.00 ± 0.02
122	1st	Room 3	B	Door Threshold	Wood	Blue	Intact	Negative	0.01 ± 0.03
123	1st	Room 3	C	Opening Casing	Wood	Green	Intact	Positive	2.80 ± 1.50
124	1st	Room 3	C	Opening Jamb	Wood	Green	Intact	Positive	3.10 ± 1.70
125	1st	Room 3	B-C	Cabinet Door Upr	Wood	Green	Intact	Negative	0.08 ± 0.14
126	1st	Room 3	B-C	Cabinet Door Lwr	Wood	Green	Intact	Negative	0.16 ± 0.32
127	1st	Room 3	B-C	Cabinet Frame	Wood	Green	Intact	Negative	0.12 ± 0.20
128	1st	Room 3	B-C	Cabinet Shelf Upr	Wood	Beige	Intact	Negative	0.13 ± 0.12
129	1st	Room 3	A	Closet Door	Wood	Green	Intact	Positive	1.60 ± 0.50
130	1st	Room 3	A	Closet Casing	Wood	Green	Intact	Negative	0.18 ± 0.16
131	1st	Room 3	A	Closet Shelf	Wood	Wallpaper	Intact	Negative	0.10 ± 0.13
132	1st	Room 3	A	Closet Wall	Plaster	White	Peeling	Negative	0.01 ± 0.02
133	1st	Room 3	A	Closet Wall	Plaster	White	Peeling	Negative	0.01 ± 0.03
134	1st	Room 3	A	Closet Ceiling	Plaster	White	Peeling	Negative	0.00 ± 0.02
135	1st	Room 3	C	Baseboard	Wood	Green	Intact	Negative	0.70 ± 0.30
137	1st	Room 3	A	Fireplace Mantel	Wood	Green	Intact	Positive	7.40 ± 4.00
138	1st	Room 3	A	Fireplace Trim	Wood	Green	Intact	Positive	2.80 ± 1.50
139	1st	Room 3	A	Fireplace Hearth	Brick	Brown	Intact	Negative	0.28 ± 0.11
140	1st	Room 3	A	Fireplace Hearth	Brick	Brown	Intact	Negative	0.30 ± 0.18
141	1st	Room 3	D	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
143	1st	Room 3	A	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
144	1st	Room 3	B	Wall	Drywall	White	Intact	Negative	0.00 ± 0.02
145	1st	Room 3	C	Wall	Plaster	White	Intact	Negative	0.01 ± 0.02
146	1st	Room 3	D	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
147	1st	Room 3	B	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
148	1st	Room 3	B	Ceiling Trim	Wood	White	Intact	Negative	0.01 ± 0.03
149	1st	Room 3	C	Floor	Wood	Brown	Intact	Negative	0.00 ± 0.03
150	1st	Room 4	B	Window Sill	Wood	Beige	Intact	Negative	0.29 ± 0.20
151	1st	Room 4	B	Window Sill	Wood	Beige	Intact	Positive	2.50 ± 1.40
152	1st	Room 4	B	Window Casing	Wood	Beige	Intact	Negative	0.40 ± 0.30
153	1st	Room 4	B	Window Casing	Wood	Beige	Intact	Negative	0.22 ± 0.19
154	1st	Room 4	B	Window Jamb	Wood	Beige	Intact	Negative	0.08 ± 0.12
155	1st	Room 4	B	Window Sash Int.	Wood	Beige	Intact	Positive	4.00 ± 2.30

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
156	1st	Room 4	D	Opening Jamb	Wood	Beige	Intact	Positive	4.70 ± 2.60
157	1st	Room 4	D	Opening Threshold	Wood	Brown	Intact	Positive	2.70 ± 1.60
158	1st	Room 4	A	Door	Wood	Varnish	Intact	Positive	2.00 ± 0.80
159	1st	Room 4	A	Closet Door	Wood	Varnish	Intact	Positive	4.40 ± 2.80
160	1st	Room 4	A	Closet Door Int.	Wood	Green	Poor	Positive	47.90 ± 12.60
161	1st	Room 4	A	Closet Jamb	Wood	Green	Poor	Positive	35.10 ± 23.40
162	1st	Room 4	A	Closet Shelf	Wood	Wallpaper	Intact	Positive	9.90 ± 7.10
163	1st	Room 4	A	Closet Shelf	Wood	Wallpaper	Intact	Positive	8.00 ± 4.40
164	1st	Room 4	A	Closet Shelf B	Wood	Brown	Peeling	Positive	13.80 ± 10.10
165	1st	Room 4	A	Closet Wall	Plaster	Wallpaper	Intact	Positive	28.80 ± 20.40
167	1st	Room 4	B	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
168	1st	Room 4	B	Baseboard	Wood	Beige	Intact	Null	1.40 ± 0.50
169	1st	Room 4	B	Baseboard	Wood	Beige	Intact	Positive	2.00 ± 0.70
170	1st	Room 4	A	Fireplace Mantel	Wood	Varnish	Intact	Negative	0.06 ± 0.08
171	1st	Room 4	A	Wall - Upper	Wood	Varnish	Intact	Negative	0.04 ± 0.07
172	1st	Room 4	A	Wall - Lower	Wood	Varnish	Intact	Null	0.90 ± 0.60
173	1st	Room 4	A	Wall - Lower	Wood	Varnish	Intact	Negative	0.18 ± 0.21
174	1st	Room 4	A	Fireplace Hearth	Brick	Brown	Intact	Positive	1.20 ± 0.20
175	1st	Room 4	A	Fireplace Hearth	Brick	Brown	Intact	Positive	3.00 ± 1.70
176	1st	Room 4	B	Wall	Plaster	White	Intact	Negative	0.04 ± 0.07
177	1st	Room 4	C	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
178	1st	Room 4	D	Wall	Plaster	White	Intact	Negative	0.01 ± 0.03
179	1st	Room 4	D	Ceiling	Plaster	White	Peeling	Negative	0.00 ± 0.02
180	1st	Room 4	D	Floor	Wood	Brown	Intact	Positive	3.00 ± 1.90
181	1st	Room 4	B	Floor	Wood	Brown	Intact	Positive	3.60 ± 2.20
182	1st	Kitchen	C	Window Sill	Wood	White	Intact	Negative	0.00 ± 0.02
183	1st	Kitchen	C	Window Casing	Wood	White	Intact	Negative	0.00 ± 0.02
184	1st	Kitchen	C	Window Sash Int.	Wood	White	Intact	Negative	0.00 ± 0.02
185	1st	Kitchen	C	Window Well	Wood	White	Intact	Negative	0.02 ± 0.06
186	1st	Kitchen	D	Window Casing	Wood	White	Intact	Negative	0.26 ± 0.35
188	1st	Kitchen	D	Window Sash Int.	Wood	White	Intact	Positive	2.70 ± 1.60
189	1st	Kitchen	A	Opening Casing	Wood	White	Intact	Positive	2.80 ± 1.40
190	1st	Kitchen	D	Door	Metal	White	Intact	Negative	0.00 ± 0.02
191	1st	Kitchen	D	Door Jamb	Wood	White	Intact	Negative	0.00 ± 0.02
192	1st	Kitchen	D	Door Casing	Wood	White	Intact	Negative	0.01 ± 0.06
193	1st	Kitchen	A	Baseboard	Wood	White	Intact	Negative	0.70 ± 0.30
194	1st	Kitchen	D	Radiator	Metal	Silver	Intact	Negative	0.00 ± 0.02
195	1st	Kitchen	C	Cabinet Door Lwr	Wood	Brown	Intact	Negative	0.00 ± 0.02
196	1st	Kitchen	C	Cabinet Frame	Wood	Brown	Intact	Negative	0.00 ± 0.02
197	1st	Kitchen	A	Wall	Plaster	Yellow	Intact	Positive	4.80 ± 3.40
198	1st	Kitchen	B	Wall	Drywall	Yellow	Intact	Negative	0.00 ± 0.02
199	1st	Kitchen	C	Wall	Drywall	Yellow	Intact	Null	0.03 ± 0.11
200	1st	Kitchen	C	Wall	Drywall	Yellow	Intact	Negative	0.00 ± 0.02
201	1st	Kitchen	D	Wall	Drywall	Yellow	Intact	Negative	0.00 ± 0.02
202	1st	Kitchen	D	Ceiling	Drywall	White	Intact	Negative	0.03 ± 0.11
203	1st	Room 5	C	Window Sill	Wood	Brown	Intact	Negative	0.00 ± 0.02
204	1st	Room 5	C	Window Casing	Wood	Brown	Intact	Negative	0.01 ± 0.03
205	1st	Room 5	C	Window Sash Int.	Wood	Brown	Intact	Negative	0.00 ± 0.02
206	1st	Room 5	C	Window Sash Ext.	Wood	White	Intact	Negative	0.00 ± 0.02

Connecticut Lead Paint Solutions, LLC
 1245 Hebron Ave
 Glastonbury, CT 06033
 860-633-3330 Since 1994

100 Main St, Anytown, CT 06000

February 01, 2018

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
308	2nd	Room 7	B	Wall	Plaster	Grey	Intact	Negative	0.01 ± 0.02
309	2nd	Room 7	C	Wall	Plaster	Grey	Intact	Null	0.00 ± 0.02
310	2nd	Room 7	C	Wall	Plaster	Grey	Intact	Negative	0.00 ± 0.02
311	2nd	Room 7	D	Wall	Drywall	Grey	Intact	Negative	0.05 ± 0.17
312	2nd	Room 7	C	Ceiling	Drywall	White	Intact	Negative	0.00 ± 0.02
313	2nd	Room 7	C	Floor	Wood	Brown	Intact	Negative	0.00 ± 0.02
314	2nd	Room 8	C	Window Sill	Wood	Red	Intact	Negative	0.01 ± 0.04
315	2nd	Room 8	C	Window Casing	Wood	Red	Intact	Negative	0.17 ± 0.21
316	2nd	Room 8	C	Window Sash Int.	Wood	Red	Intact	Positive	2.30 ± 1.20
317	2nd	Room 8	D	Window Sill	Wood	Red	Intact	Positive	2.10 ± 1.10
318	2nd	Room 8	D	Window Casing	Wood	Red	Intact	Positive	3.00 ± 1.60
319	2nd	Room 8	D	Window Sash Int.	Wood	Red	Intact	Negative	0.16 ± 0.14
320	2nd	Room 8	B	Door	Wood	Red	Intact	Negative	0.90 ± 0.10
321	2nd	Room 8	B	Door Casing	Wood	Red	Intact	Positive	1.70 ± 0.50
322	2nd	Room 8	C	Door	Wood	Red	Intact	Negative	0.14 ± 0.21
323	2nd	Room 8	C	Door Casing	Wood	Red	Intact	Negative	0.30 ± 0.34
324	2nd	Room 8	A	Closet Door	Wood	Red	Intact	Positive	3.10 ± 1.80
325	2nd	Room 8	A	Closet Casing	Wood	Red	Intact	Positive	1.40 ± 0.30
326	2nd	Room 8	A	Closet Wall Upr	Plaster	White	Intact	Positive	14.70 ± 10.60
327	2nd	Room 8	A	Closet Wall Trim	Plaster	White	Intact	Positive	17.00 ± 12.90
328	2nd	Room 8	A	Closet Wall	Wood	Red	Intact	Positive	7.00 ± 4.50
329	2nd	Room 8	A	Closet Floor	Wood	Green	Poor	Null	1.30 ± 0.30
330	2nd	Room 8	A	Closet Floor	Wood	Green	Poor	Positive	1.50 ± 0.50
331	2nd	Room 8	A	Cabinet Door Lwr	Wood	White	Intact	Positive	1.50 ± 0.50
332	2nd	Room 8	A	Cabinet Frame	Wood	White	Intact	Null	1.00 ± 0.10
333	2nd	Room 8	C	Cabinet Frame	Wood	White	Intact	Negative	0.22 ± 0.26
334	2nd	Room 8	C	Cabinet Door	Wood	White	Intact	Null	0.11 ± 0.29
335	2nd	Room 8	C	Cabinet Door	Wood	White	Intact	Negative	0.15 ± 0.16
336	2nd	Room 8	C	Cabinet Shelf	Wood	Red	Intact	Negative	0.09 ± 0.13
337	2nd	Room 8	C	Cabinet Wall	Plaster	Red	Intact	Negative	0.25 ± 0.06
338	2nd	Room 8	A	Shelf	Wood	White	Intact	Negative	0.70 ± 0.30
339	2nd	Room 8	A	Baseboard	Wood	Red	Intact	Positive	14.10 ± 11.30
340	2nd	Room 8	D	Radiator	Metal	Silver	Intact	Negative	0.01 ± 0.06
341	2nd	Room 8	D	Wall	Plaster	White	Intact	Negative	0.03 ± 0.04
342	2nd	Room 8	A	Wall	Plaster	White	Peeing	Negative	0.01 ± 0.02
343	2nd	Room 8	B	Wall	Plaster	White	Intact	Negative	0.01 ± 0.05
344	2nd	Room 8	C	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
345	2nd	Room 8	C	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
346	2nd	Room 8	C	Crown Molding	Wood	White	Intact	Negative	0.40 ± 0.50
347	2nd	Room 8	D	Cabinet Door Lwr	Wood	White	Intact	Positive	22.70 ± 17.80
348	2nd	Room 8	D	Cabinet Frame	Wood	White	Intact	Negative	0.16 ± 0.20
349	2nd	Room 9	C	Window Sill	Wood	Blue	Intact	Negative	0.06 ± 0.11
350	2nd	Room 9	C	Window Sill	Wood	Blue	Intact	Negative	0.08 ± 0.11
351	2nd	Room 9	C	Window Casing	Wood	Blue	Intact	Positive	18.60 ± 13.70
352	2nd	Room 9	C	Window Casing Outer	Wood	Blue	Intact	Negative	0.50 ± 0.50
353	2nd	Room 9	C	Window Sash Int.	Wood	Blue	Intact	Negative	0.00 ± 0.02
354	2nd	Room 9	B	Window Sill	Wood	Blue	Intact	Positive	3.70 ± 1.40
355	2nd	Room 9	B	Window Casing Outer	Wood	Blue	Intact	Positive	15.20 ± 10.20
356	2nd	Room 9	D	Door	Wood	Blue	Intact	Positive	12.80 ± 9.80

Connecticut Lead Paint Solutions, LLC
 1245 Hebron Ave
 Glastonbury, CT 06033
 860-633-3330 Since 1994

100 Main St, Anytown, CT 06000

February 01, 2018


Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
357	2nd	Room 9	D	Door Casing	Wood	Blue	Intact	Positive	3.50 ± 2.30
358	2nd	Room 9	A	Closet Door	Wood	Blue	Intact	Negative	0.10 ± 0.13
359	2nd	Room 9	A	Closet Door	Wood	Blue	Intact	Positive	15.50 ± 11.80
360	2nd	Room 9	A	Closet Casing	Wood	Blue	Intact	Positive	17.20 ± 12.80
361	2nd	Room 9	A	Closet Shelf	Wood	White	Fair	Positive	1.70 ± 0.70
362	2nd	Room 9	A	Closet Wall	Plaster	White	Intact	Negative	0.02 ± 0.06
363	2nd	Room 9	A	Closet Floor	Wood	Grey	Intact	Positive	2.30 ± 0.80
364	2nd	Room 9	C	Baseboard	Wood	Blue	Intact	Positive	17.30 ± 14.40
365	2nd	Room 9	B	Radiator	Metal	Silver	Fair	Negative	0.00 ± 0.02
366	2nd	Room 9	A	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
367	2nd	Room 9	B	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
368	2nd	Room 9	C	Wall	Plaster	White	Intact	Negative	0.00 ± 0.02
369	2nd	Room 9	D	Wall	Drywall	White	Intact	Negative	0.00 ± 0.02
370	2nd	Room 9	D	Ceiling	Plaster	White	Intact	Negative	0.00 ± 0.02
371	2nd	Room 9	D	Floor	Wood	Brown	Intact	Negative	0.04 ± 0.11
372	2nd	Attic Stairs	D	Door	Wood	Beige	Defective	Positive	9.30 ± 7.50
373	2nd	Attic Stairs	D	Door Jamb	Wood	Beige	Defective	Positive	12.30 ± 9.50
374	2nd	Room 10	A	Window Sill	Wood	Red	Intact	Positive	10.10 ± 7.70
375	2nd	Room 10	A	Window Sash Int.	Wood	Red	Intact	Positive	10.00 ± 8.60
376	2nd	Room 10	C	Window Casing Rht	Wood	Brown	Intact	Negative	0.01 ± 0.06
377	2nd	Room 10	A	Door	Wood	Red	Intact	Positive	4.10 ± 2.80
378	2nd	Room 10	A	Door Jamb	Wood	Red	Intact	Positive	6.20 ± 4.20
379	2nd	Room 10	A	Door Threshold	Wood	Red	Poor	Positive	5.20 ± 3.60
380	2nd	Room 10	D	Door	Wood	Brown	Intact	Negative	0.00 ± 0.02
381	2nd	Room 10	D	Door Jamb	Wood	White	Intact	Negative	0.00 ± 0.02
382	2nd	Room 10	C	Baseboard	Wood	Brown	Intact	Negative	0.00 ± 0.02
383	2nd	Room 10	B	Wall	Wood	Brown	Intact	Negative	0.00 ± 0.02
384	2nd	Room 10	C	Wall	Wood	Brown	Intact	Negative	0.00 ± 0.02
385	2nd	Room 10	D	Wall	Wood	Brown	Intact	Negative	0.00 ± 0.02
389	2nd	Room 10	C	Ceiling	Wood	White	Intact	Negative	0.00 ± 0.02
390	2nd	Room 10	C	Ceiling	Wood	White	Intact	Null	0.00 ± 0.02
391	2nd	Balcony	B	Door	Wood	Red	Intact	Negative	0.00 ± 0.02
392	2nd	Balcony	B	Door Jamb	Wood	White	Intact	Negative	0.01 ± 0.03
393	2nd	Balcony	B	Window Sill	Wood	White	Poor	Negative	0.01 ± 0.04
394	2nd	Balcony	B	Window Casing	Wood	White	Intact	Negative	0.00 ± 0.02
395	2nd	Balcony	B	Ext. Siding	Wood	Red	Intact	Negative	0.01 ± 0.03
396	2nd	Balcony	A	Ext. Fascia	Wood	White	Intact	Null	1.20 ± 0.40
397	2nd	Balcony	A	Ext. Fascia	Wood	White	Intact	Positive	1.50 ± 0.50
398	2nd	Balcony	A	Ext. Soffit	Wood	White	Intact	Null	1.20 ± 0.30
399	2nd	Balcony	A	Ext. Soffit	Wood	White	Intact	Positive	28.10 ± 20.40
400	2nd	Balcony	D	Porch Baluster	Wood	White	Intact	Negative	0.00 ± 0.02
401	2nd	Balcony	D	Porch Rail Cap	Wood	White	Poor	Negative	0.00 ± 0.02
402	Exterior	A	Door	Wood	Blue	Intact	Negative	0.50 ± 0.30	
403	Exterior	A	Door	Wood	Blue	Intact	Null	1.00 ± 0.20	
404	Exterior	A	Door Jamb	Wood	White	Intact	Positive	2.00 ± 0.80	
405	Exterior	A	Door Side Lite	Wood	White	Intact	Positive	2.40 ± 0.90	
406	Exterior	A	Window Sill Lft	Wood	White	Peeling	Negative	0.21 ± 0.30	
407	Exterior	A	Window Sill Lft	Wood	White	Peeling	Negative	0.40 ± 0.40	
408	Exterior	A	Window Casing	Wood	White	Intact	Positive	12.80 ± 10.90	

Connecticut Lead Paint Solutions, LLC
 1245 Hebron Ave
 Glastonbury, CT 06033
 860-633-3330 Since 1994


100 Main St, Anytown, CT 06000

February 01, 2018

Index	FL.	ROOM	SIDE	COMPONENT	SUBSTRATE	COLOR	CONDITION	Results	PbC
409		Exterior	B	Window Sill Lft	Wood	White	Intact	Negative	0.25 ± 0.35
410		Exterior	B	Window Casing	Wood	White	Intact	Positive	3.70 ± 2.30
411		Exterior	B	Cell Window Sash	Wood	White	Intact	Positive	7.50 ± 3.20
412		Exterior	B	Cell Window Frame	Wood	White	Intact	Positive	8.20 ± 6.50
413		Exterior	C	Bulkhead Door	Wood	Red	Fair	Negative	0.00 ± 0.02
414		Exterior	C	Bulkhead Frame	Wood	Red	Intact	Negative	0.00 ± 0.02
415		Exterior	B	Ext. Siding	Wood	Red	Intact	Negative	0.11 ± 0.17
416		Exterior	C	Ext. Siding	Wood	Red	Intact	Negative	0.01 ± 0.03
417		Exterior	C	Window Sash Ext. Kit.	Wood	White	Intact	Negative	0.00 ± 0.02
418		Exterior	C	Window Casing Ext.	Wood	White	Intact	Negative	0.01 ± 0.06
420		Exterior	C	Door	Wood	Red	Intact	Negative	0.00 ± 0.02
421		Exterior	C	Door Casing	Wood	White	Fair	Negative	0.00 ± 0.02
422		Exterior	C	Porch Lwr Trim	Wood	White	Intact	Negative	0.00 ± 0.02
423		Exterior	D	Porch Lattice	Wood	White	Intact	Negative	0.00 ± 0.02
424		Exterior	D	Ext. Siding	Wood	Red	Intact	Negative	0.13 ± 0.37
426		Exterior	D	Wind. Sash Ext. Rm 10	Wood	White	Intact	Negative	0.01 ± 0.04
427		Exterior	D	Window Sill Lft	Wood	White	Intact	Negative	0.80 ± 0.20
429				Calibration- Surface			1.53mg/cm²	Positive	1.60 ± 0.20
430				Calibration- Buried			1.04mg/cm²	Positive	1.30 ± 0.20
431				Calibration- Buried			1.04mg/cm²	Positive	1.10 ± 0.10
432				Calibration- Buried			1.04mg/cm²	Positive	1.10 ± 0.10
433				Calibration- Buried			1.04mg/cm²	Positive	1.10 ± 0.10
434				Calibration- Buried			0.01mg/cm²	Negative	0.00 ± 0.02

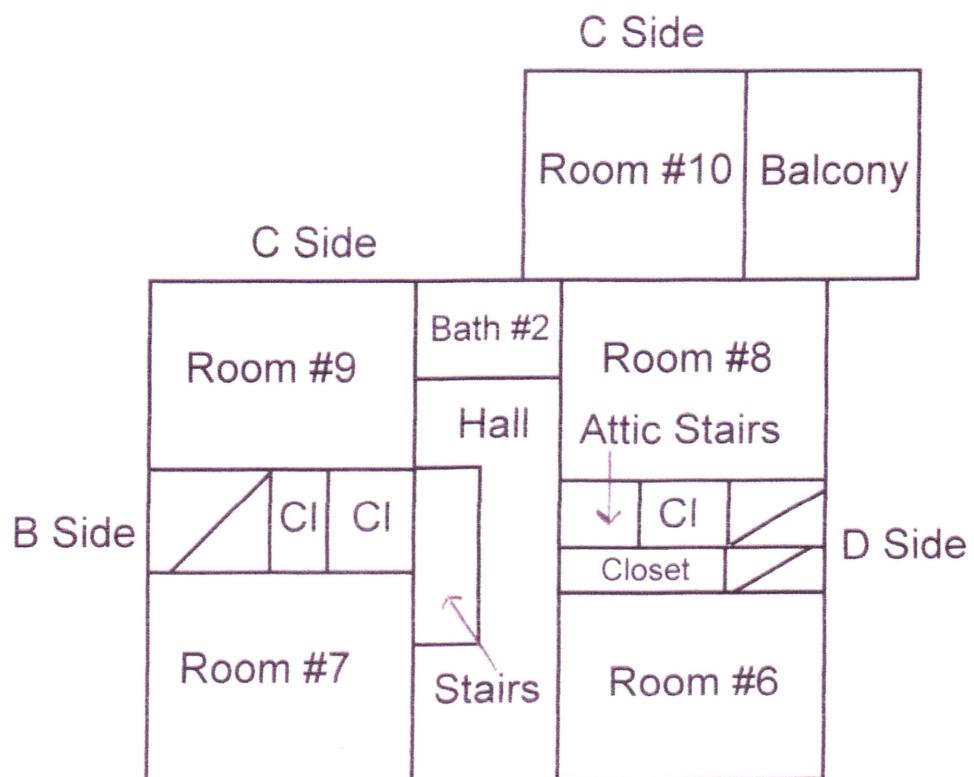

A Side 2nd floor

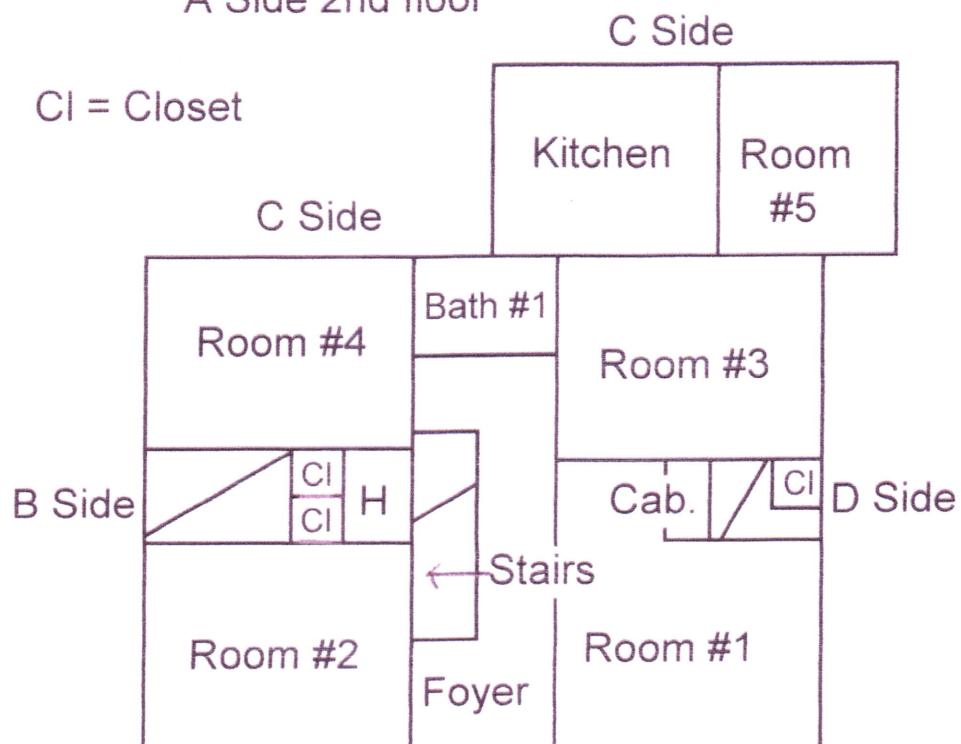

A Side 1st Floor

~~125 River Rd, Wethersfield, CT 06516~~

