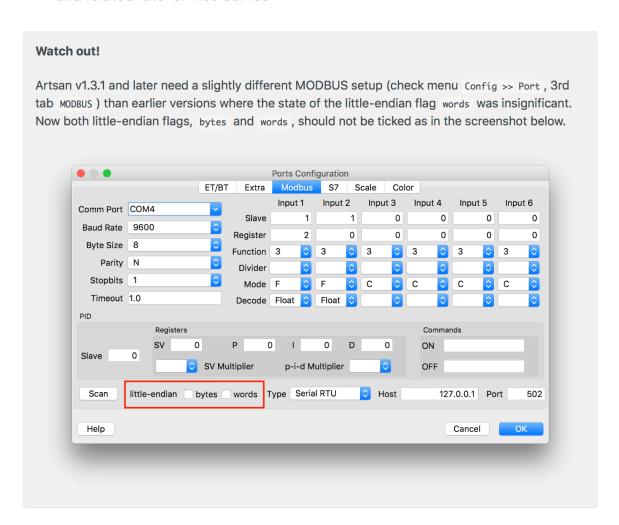ARTISAN BUG FIX FOR VERSION 1.3.1 & UP for BC Rosters

A bug was just discovered with the latest version of Artisan when setting up for BC Roasters. Please see fix on Artisan website as listed below:

https://artisan-scope.org/machines/bc/

- **Producer:** Buckeye Coffee Roasters Co. LCC, USA

- **Machines:** all with USB or Bluetooth connection

- **Connection:** MODBUS RTU; requires the installation of a serial driver

- **Features:** logging of environmental temperature (ET), bean temperature (BT) and related rate-of-rise curves

Watch out!

Artsan v1.3.1 and later need a slightly different MODBUS setup (check menu `Config >> Port`, 3rd tab `MODBUS`) than earlier versions where the state of the little-endian flag `words` was insignificant. Now both little-endian flags, `bytes` and `words`, should not be ticked as in the screenshot below.

ARTISAN BUG FIX FOR VERSION 1.3.1 & UP for BC Rosters