UNITED STATES DEPARTMENT OF STATE
U.S. EMBASSY
MONTEVIDEO, URUGUAY

NOTES:

1. INSTALL NEW ROOF SYSTEM AS SPECIFIED AND GENERALLY DEPICTED IN DETAIL 'B'.
2. INSTALL NEW COVERING OVER EXISTING PIPE CHASE AS DEPICTED IN DETAILS D8/A08 AND D9/A08.
3. INSTALL NEW WALK PADS AT ROOF ACCESS POINTS, AROUND EQUIPMENT AND AS DEPICTED ON THIS PLAN.
4. CONCRETE CURBS TO REMAIN SHALL RECEIVE NEW FLASHINGS AS DEPICTED IN DETAILS D5/A07 AND D5/A08. EXPOSED CONCRETE TO BE COATED WITH ELASTOMERIC COATING.
5. CLEAN AND PAINT EXISTING SHEET METAL FABRICATIONS(TYP) TO REMAIN
6. REFER TO TAPER PLANS A05 AND A06 FOR INSULATION LAYOUT.
7. INSTALL NEW CONCRETE PAVERS ON PROTECTION PAD TO BE LOCATED BELOW DISCHARGE PORT OF EXHAUST VENT.

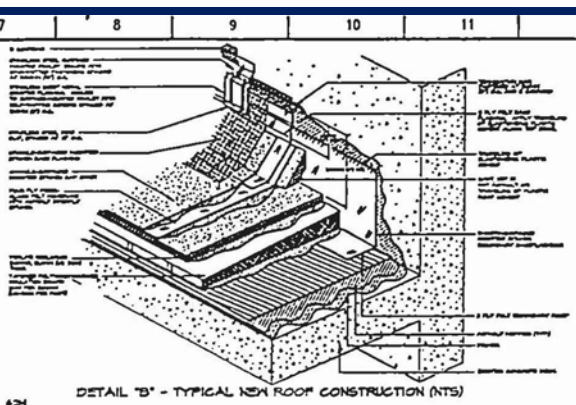

DETAIL "B" - TYPICAL NEW ROOF CONSTRUCTION (NTS)

ROOF PLAN: NEW CONDITIONS/DETAILS

United States Department of State
OFFICE OF FOREIGN BUILDINGS OPERATIONS
Washington, D.C.

ROOF REPLACEMENT
for
CHANCERY BUILDING
MONTEVIDEO
URUGUAY

LEGEND
- SCUPPER / ROOF DRAIN (E.R.D.) - EXISTING ROOF DRAIN
- ROOF DRAIN (E.R.D.) - EXISTING ROOF DRAIN
- VENT
- EQUIPMENT CURB
- ROOF HATCH
- FENCE
- AREA IDENTIFICATION
- SCUPPER WITH SPLASH BLOCK
- PIPE PENETRATION
- CONCRETE PAD
- CABLES
- WALK PAD
- EQUIPMENT SUPPORT
- ANTENNA

PRICE CONSULTING INC.

ROOF PLAN
(NEW CONDITIONS/DETAILS)

OBC
A04