

Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6111

Area Offices

210 Beech Street

Texarkana, AR 71854

(870) 772-0013

707 West Cotton St.

Longview, TX 75604

(903) 758-0402

2000 E Randol Mill Rd. Ste 613

Arlington, TX 76011

(817) 962-0048

Acct ID: WESTHENLY

Proj. No.: C7229169

Date Sampled: 02/29/2016

Report Date: 03/02/2016

Sampled By: SUTHERLAND, TYLER

Project: West Henly Materials

By Order Of:

Location: Johnson City Plant

Order Number:

Client: West Henly Materials

Contractor:

REPORT: **Proctor**

LAB NO: 92


Material: 3/4 Screenings


Test Method: See Below

TEST RESULTS

Report No: 92

Page 1 of 4

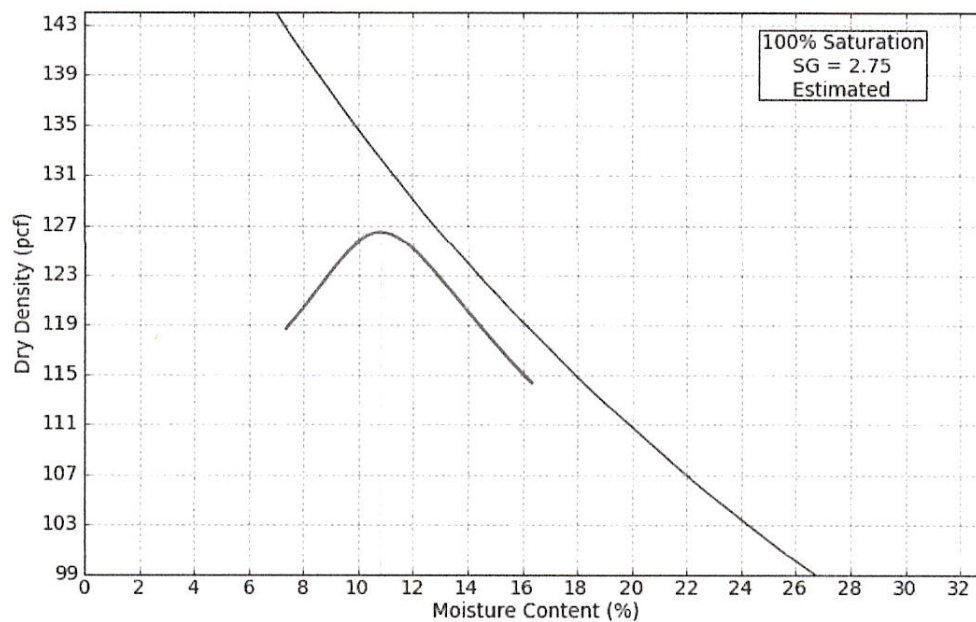

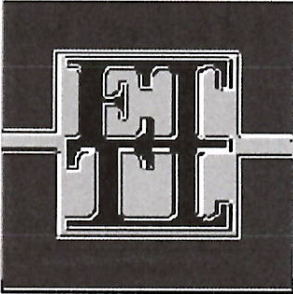

Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6111

Area Offices

210 Beech Street	Texarkana, AR 71854	(870) 772-0013
707 West Cotton St.	Longview, TX 75604	(903) 758-0402
2000 E Randol Mill Rd. Ste 613	Arlington, TX 76011	(817) 962-0048

Acct ID: WESTHENLY
Report Date: 03/02/2016
Project: West Henly Materials
Location: Johnson City Plant
Client: West Henly Materials
Contractor:

Proj. No.: C7229169

Date Sampled: 02/29/2016

Sampled By: SUTHERLAND, TYLER

By Order Of:

Order Number:

REPORT: **Proctor**

LAB NO: 92

Material: 3/4 Screenings

Test Method: See Below

TEST RESULTS

Report No: 92

Page 2 of 4

<u>% Moisture</u>	<u>Dry Density Lbs./Cu.Ft.</u>	<u>Sieve</u>	<u>% Passing</u>
8.4	120.9	1 3/4 in Sieve:	100
10.7	126.5	1 1/4 in Sieve:	100
12.5	123.3	7/8 in Sieve:	100
15.3	116.8	5/8 in Sieve:	93
		3/8 in Sieve:	75
Optimum	Maximum	Sieve No. 4:	56
10.8	126.5	Sieve No. 40:	26
		Sieve No. 200	14

Color: Tan

Description: Gravelly Silty Clay with Sand

Liquid Limit: 19

Plastic Limit: 14


Plasticity Index: 5

Group Symbol: CL-ML

Desc of Rammer: Mechanical

Preparation Method: Moist

Test Method (As Applicable): Tex-113-E, Tex-101-E, Tex-104-E, Tex-105-E, Tex-106-E, Tex-401-A

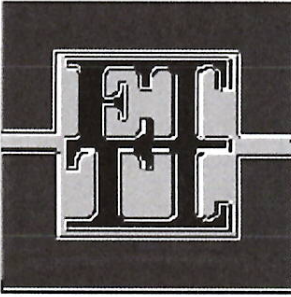

Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6111

Area Offices

210 Beech Street

Texarkana, AR 71854

(870) 772-0013

707 West Cotton St.

Longview, TX 75604

(903) 758-0402

2000 E Randol Mill Rd. Ste 613

Arlington, TX 76011

(817) 962-0048

Acct ID: WESTHENLY

Proj. No.: C7229169

Date Sampled: 02/29/2016

Report Date: 03/02/2016

Sampled By: SUTHERLAND, TYLER

Project: West Henly Materials

By Order Of:

Location: Johnson City Plant

Order Number:

Client: West Henly Materials

Contractor:

REPORT: **Proctor**

LAB NO: 92


Material: 3/4 Screenings


Test Method: See Below

TEST RESULTS

Report No: 92

Page 3 of 4

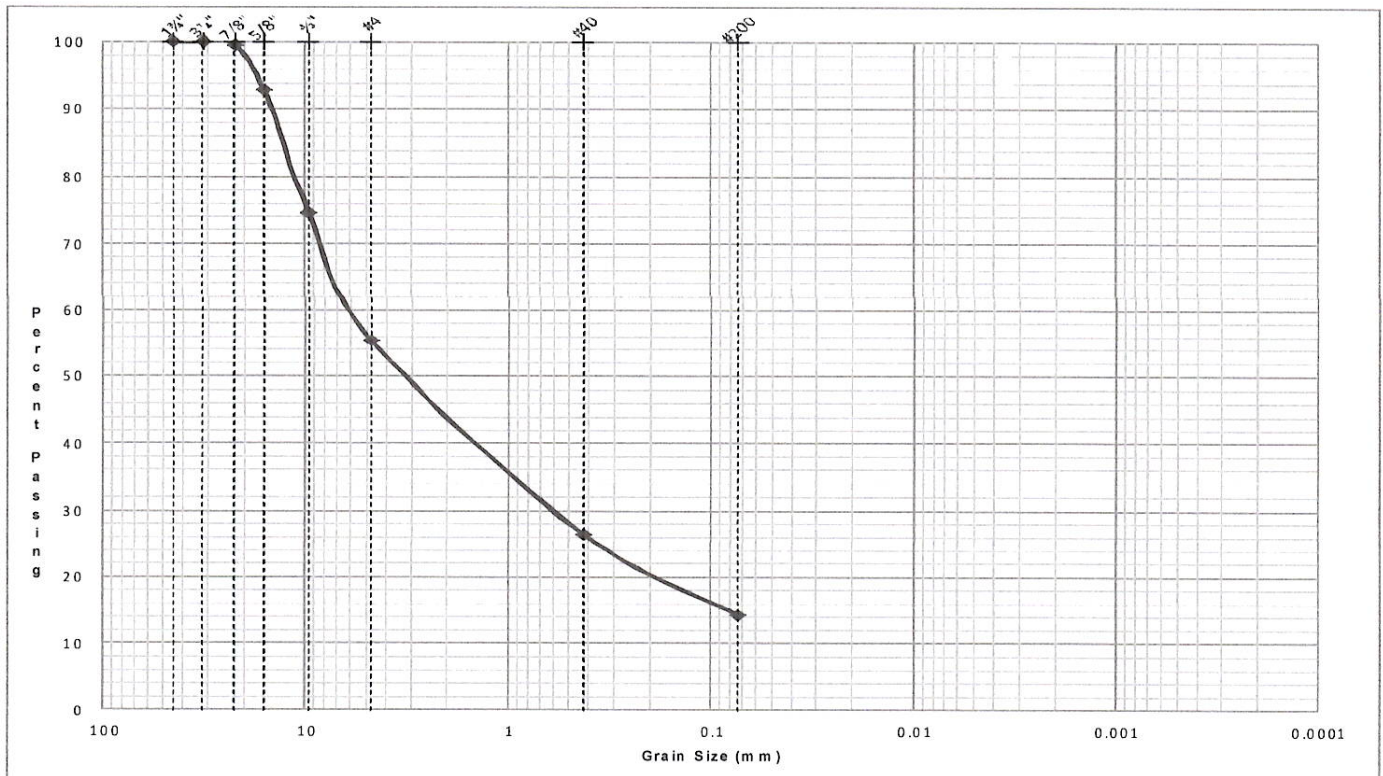

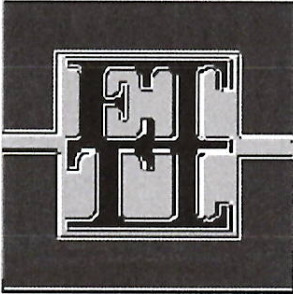

Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6111

Area Offices

210 Beech Street

Texarkana, AR 71854

(870) 772-0013

707 West Cotton St.

Longview, TX 75604

(903) 758-0402

2000 E Randol Mill Rd. Ste 613

Arlington, TX 76011

(817) 962-0048

Acct ID: WESTHENLY

Proj. No.: C7229169

Date Sampled: 02/29/2016

Report Date: 03/02/2016

Sampled By: SUTHERLAND, TYLER

Project: West Henly Materials

By Order Of:

Location: Johnson City Plant

Order Number:

Client: West Henly Materials

Contractor:

REPORT: **Proctor**

LAB NO: 92


Material: 3/4 Screenings

Test Method: See Below

TEST RESULTS

Report No: 92

Page 4 of 4

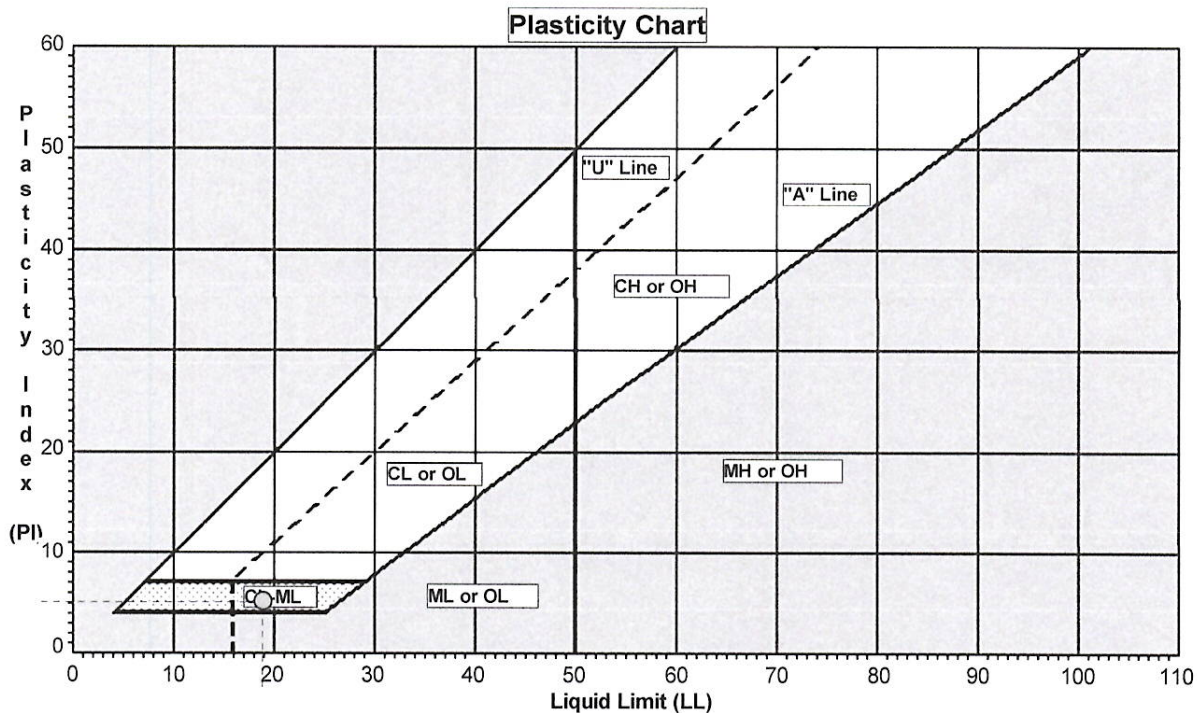

Respectfully Submitted,
ETTL Engineers & Consultants, Inc.

CHRIS TAYLOR, SET

THIS REPORT APPLIES ONLY TO THE STANDARDS OR PROCEDURES INDICATED AND TO THE SAMPLE(S) TESTED AND/OR OBSERVED AND ARE NOT NECESSARILY INDICATIVE OF THE QUALITIES OF APPARENTLY IDENTICAL OR SIMILAR PRODUCTS OR PROCEDURES, NOR DO THEY REPRESENT AN ONGOING QUALITY ASSURANCE PROGRAM UNLESS SO NOTED. THESE REPORTS ARE FOR THE EXCLUSIVE USE OF THE ADDRESSED CLIENT AND ARE NOT TO BE REPRODUCED WITHOUT WRITTEN PERMISSION.

REPORT CREATED BY ElmTree SYSTEM