



Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6113

Area Offices

210 Beech Street

Texarkana, AR 71854

(870) 772-0013

707 West Cotton St.

Longview, TX 75604

(903) 758-0402

2000 E Randol Mill Rd. Ste 613

Arlington, TX 76011

(817) 962-0048

Acct ID: TEKCONST

Proj. No.: C7182169

Date Sampled: 02/05/2016

Report Date: 02/09/2016

Sampled By: SUTHERLAND, TYLER

Project: Caliterra Welcome Center

By Order Of:

Location: Imported Select Fill

Order Number:

Client: TEK Construction

Contractor:

REPORT: **Proctor**

LAB NO: 62


Material: Imported Select Fill

Test Method: See Below

**TEST RESULTS**

Report No: 62

**Page 1 of 4**

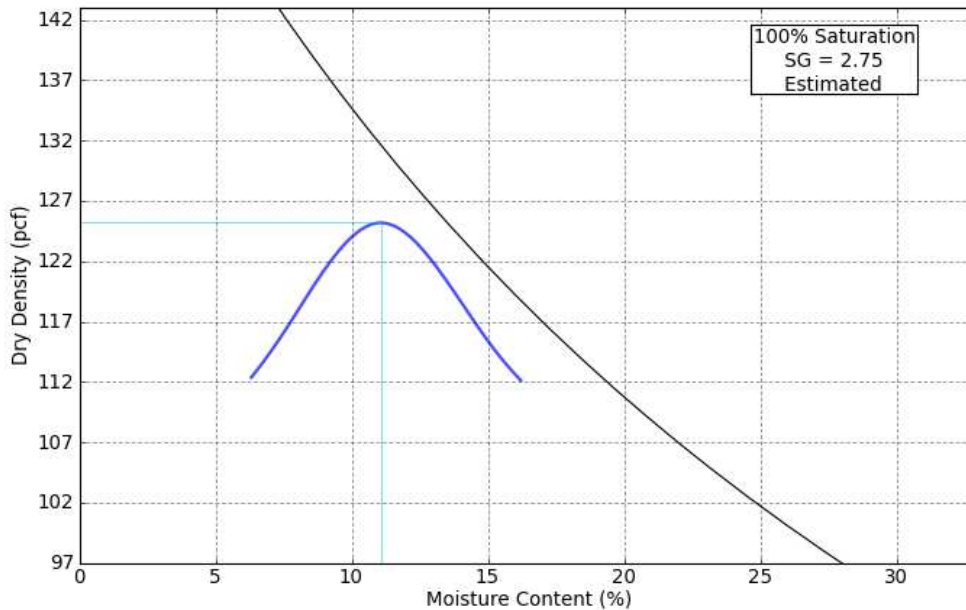

Orig: TEK Construction Attn: Theo E. Krenek Jr. E-Mail: tkrenek@tekconst.com  
1-ec ETTL Engineers and Consultants Inc. Attn: Chris Taylor  
E-Mail: ctaylor@ettlinc.com

THIS REPORT APPLIES ONLY TO THE STANDARDS OR PROCEDURES INDICATED AND TO THE SAMPLE(S) TESTED AND/OR OBSERVED AND ARE NOT NECESSARILY INDICATIVE OF THE QUALITIES OF APPARENTLY IDENTICAL OR SIMILAR PRODUCTS OR PROCEDURES, NOR DO THEY REPRESENT AN ONGOING QUALITY ASSURANCE PROGRAM UNLESS SO NOTED. THESE REPORTS ARE FOR THE EXCLUSIVE USE OF THE ADDRESSED CLIENT AND ARE NOT TO BE REPRODUCED WITHOUT WRITTEN PERMISSION.

REPORT CREATED BY ElmTree SYSTEM



Home Office - 1717 East Erwin Street

Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6113

Area Offices

210 Beech Street	Texarkana, AR 71854	(870) 772-0013
707 West Cotton St.	Longview, TX 75604	(903) 758-0402
2000 E Randol Mill Rd. Ste 613	Arlington, TX 76011	(817) 962-0048

Acct ID: TEKCONST

Proj. No.: C7182169

Date Sampled: 02/05/2016

Report Date: 02/09/2016

Sampled By: SUTHERLAND, TYLER

Project: Caliterra Welcome Center

By Order Of:

Location: Imported Select Fill

Order Number:

Client: TEK Construction

Contractor:

REPORT: **Proctor**

LAB NO: 62

Material: Imported Select Fill

Test Method: See Below

**TEST RESULTS**

Report No: 62

**Page 2 of 4**

<u>% Moisture</u>	<u>Dry Density Lbs./Cu.Ft.</u>	<u>Sieve</u>	<u>% Passing</u>	<u>Required</u>	Color: Tan
7.3	115.4	1 3/4 in Sieve:	100	100	Description: Clayey sand with gravel
9.1	121.1	1 1/2 in Sieve:	92	85-100	
11.0	125.2	3/4 in Sieve:	72	45-75	
13.1	121.0	Sieve No. 4:	52	25-70	
15.2	114.7	Sieve No. 40:	35	25-40	
Optimum	Maximum	Sieve No. 200	25		
<b>11.1</b>	<b>125.2</b>				
					<u>Required</u>
					Liquid Limit: 26 < 35
					Plastic Limit: 17
					Plasticity Index: 9 3-15
					Group Symbol: SC

Desc of Rammer: Mechanical

Preparation Method: Moist

Test Method (As Applicable): ASTM D-1557 Method-C, ASTM D-1140, ASTM D-4318, ASTM C-136

Orig: TEK Construction Attn: Theo E. Krenek Jr. E-Mail: tkrenek@tekconst.com  
 1-ec E TTL Engineers and Consultants Inc. Attn: Chris Taylor  
 E-Mail: ctaylor@ettlinc.com

THIS REPORT APPLIES ONLY TO THE STANDARDS OR PROCEDURES INDICATED AND TO THE SAMPLE(S) TESTED AND/OR OBSERVED AND ARE NOT NECESSARILY INDICATIVE OF THE QUALITIES OF APPARENTLY IDENTICAL OR SIMILAR PRODUCTS OR PROCEDURES, NOR DO THEY REPRESENT AN ONGOING QUALITY ASSURANCE PROGRAM UNLESS SO NOTED. THESE REPORTS ARE FOR THE EXCLUSIVE USE OF THE ADDRESSED CLIENT AND ARE NOT TO BE REPRODUCED WITHOUT WRITTEN PERMISSION.

REPORT CREATED BY ElmTree SYSTEM



Home Office - 1717 East Erwin Street  
Tyler, Texas 75702-6398

Office: (903) 595-4421 Lab: (903) 595-6402 Fax: (903) 595-6113

Area Offices

210 Beech Street	Texarkana, AR 71854	(870) 772-0013
707 West Cotton St.	Longview, TX 75604	(903) 758-0402
2000 E Randol Mill Rd. Ste 613	Arlington, TX 76011	(817) 962-0048

Acct ID: TEKCONST

Proj. No.: C7182169

Date Sampled: 02/05/2016

Report Date: 02/09/2016

Sampled By: SUTHERLAND, TYLER

Project: Caliterra Welcome Center

By Order Of:

Location: Imported Select Fill

Order Number:

Client: TEK Construction

Contractor:

REPORT: **Proctor**

LAB NO: 62


Material: Imported Select Fill

Test Method: See Below

**TEST RESULTS**

Report No: 62

Page 3 of 4

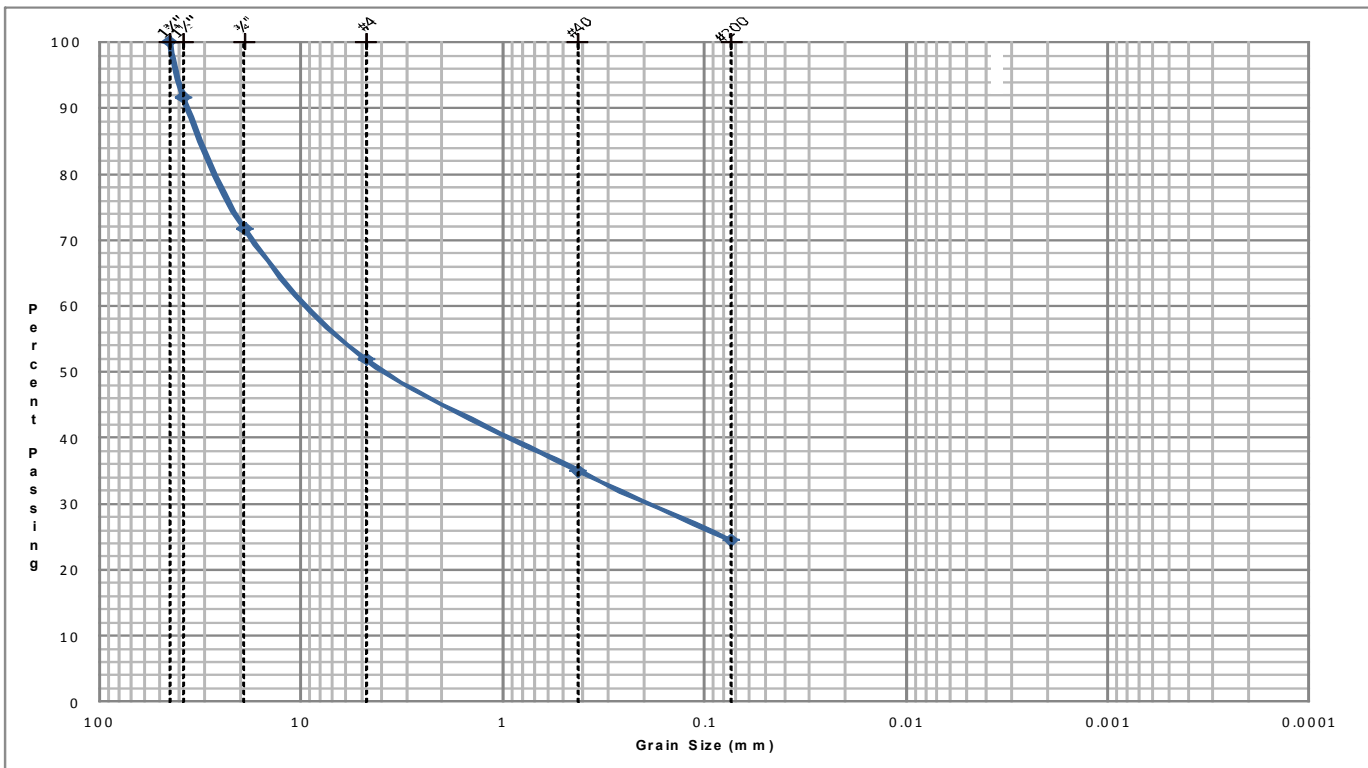

Orig: TEK Construction Attn: Theo E. Krenek Jr. E-Mail: tkrenk@tekconst.com  
1-ec E TTL Engineers and Consultants Inc. Attn: Chris Taylor  
E-Mail: ctaylor@ettlinc.com

THIS REPORT APPLIES ONLY TO THE STANDARDS OR PROCEDURES INDICATED AND TO THE SAMPLE(S) TESTED AND/OR OBSERVED AND ARE NOT NECESSARILY INDICATIVE OF THE QUALITIES OF APPARENTLY IDENTICAL OR SIMILAR PRODUCTS OR PROCEDURES, NOR DO THEY REPRESENT AN ONGOING QUALITY ASSURANCE PROGRAM UNLESS SO NOTED. THESE REPORTS ARE FOR THE EXCLUSIVE USE OF THE ADDRESSED CLIENT AND ARE NOT TO BE REPRODUCED WITHOUT WRITTEN PERMISSION.

REPORT CREATED BY ElmTree SYSTEM



Area Offices

210 Beech Street  
707 West Cotton St.  
2000 E Randol Mill Rd. Ste 613

Texarkana, AR 71854  
Longview, TX 75604  
Arlington, TX 76011

(870) 772-0013  
(903) 758-0402  
(817) 962-0048

Acct ID: TEKCONST

Proj. No.: C7182169

Date Sampled: 02/05/2016

Report Date: 02/09/2016

Sampled By: SUTHERLAND, TYLER

Project: Caliterra Welcome Center

By Order Of:

Location: Imported Select Fill

Order Number:

Client: TEK Construction

Contractor:

REPORT: Proctor


LAB NO: 62

Material: Imported Select Fill

Test Method: See Below

TEST RESULTS

Report No: 62

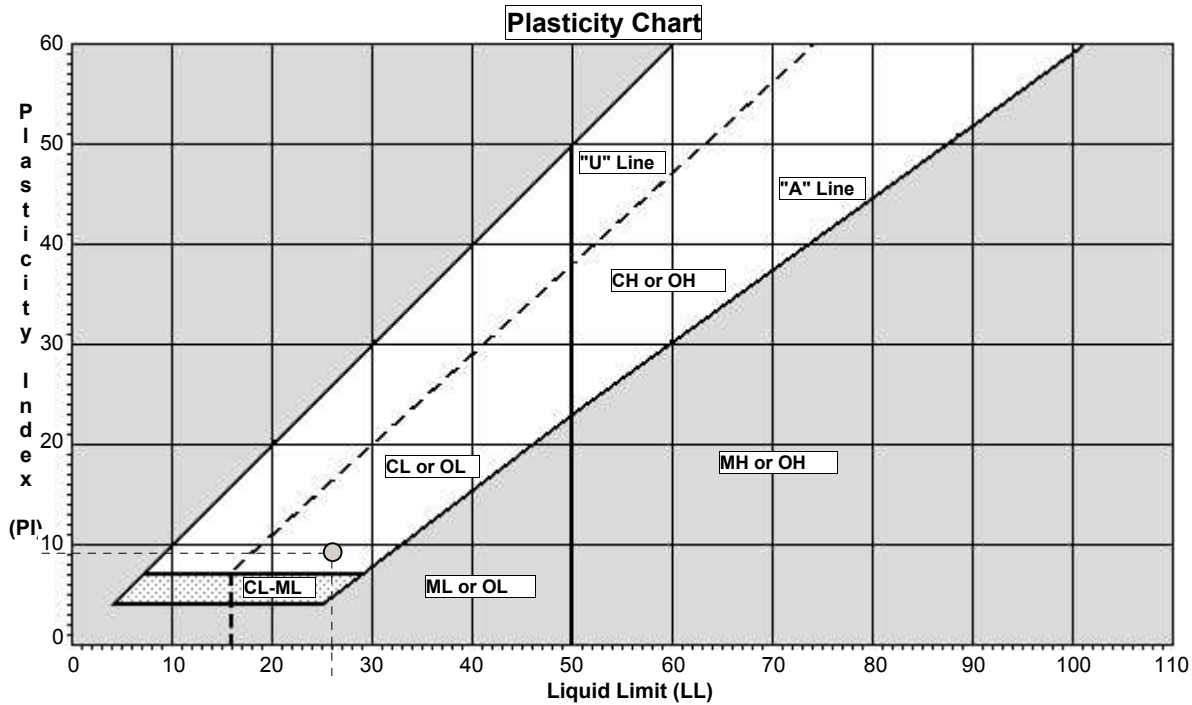

Orig: TEK Construction Attn: Theo E. Krenek Jr. E-Mail: tkrenek@tekconst.com  
1-ec E TTL Engineers and Consultants Inc. Attn: Chris Taylor  
E-Mail: ctaylor@ettlinc.com

Respectfully Submitted,  
ETTL Engineers & Consultants, Inc.

CHRIS TAYLOR, SET

THIS REPORT APPLIES ONLY TO THE STANDARDS OR PROCEDURES INDICATED AND TO THE SAMPLE(S) TESTED AND/OR OBSERVED AND ARE NOT NECESSARILY INDICATIVE OF THE QUALITIES OF APPARENTLY IDENTICAL OR SIMILAR PRODUCTS OR PROCEDURES, NOR DO THEY REPRESENT AN ONGOING QUALITY ASSURANCE PROGRAM UNLESS SO NOTED. THESE REPORTS ARE FOR THE EXCLUSIVE USE OF THE ADDRESSED CLIENT AND ARE NOT TO BE REPRODUCED WITHOUT WRITTEN PERMISSION.