

Replacement coil solutions!

Carrier/Bryant/ICP F-series Air Handler replacement coils

Revision Date: 7/17/17

Slope Model	Face Area	Rows	Α	В	F	G
**218S18	2.23 sq ft	2	21"	18"	3/8	3/4
318S2430	2.23 sq ft	3	21"	18"	3/8	3/4
324S3036	2.97 sq ft	3	21"	24"	3/8	3/4
328S3642	3.46 sq ft	3	21"	28"	3/8	7/8

^{**} Denotes possible non stock item, please contact factory for availability


All slope coils have the following characteristics in common:


Pre-punched brackets to accept coil support columns


Pre-installed side block off baffles for proper fit

Pre-installed coil top seal

Line sets positioned to fit access panel location

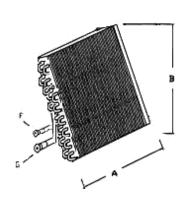

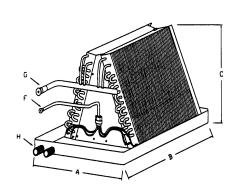

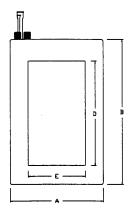

A-coil pictured above for dimensional use only and does not accurately depict liquid and suction line location.

"A" MODEL	Α	В	С	D	Е	F	G	Н
*314A2430	15 3/4	20 5/8	14 1/2	17 1/2	9 3/4	3/8	3/4	3/4
*318A4248	19 1/4	20 5/8	18 1/2	17 1/2	13 1/4	3/8	7/8	3/4
*324A4860	19 1/4	20 5/8	24 1/2	17 1/2	13 1/4	3/8	7/8	3/4
424A60+TXV	22 3/4	20 5/8	24 1/2	17 1/2	14 1/4	3/8	7/8	3/4

^{*}A-coil top baffle sized to accept horizontal top seal from replaced coil

Metal pan coated for rust protection, drains match air handler access panel location Drain pan equipped with coil brackets for proper mounting

All coils utilize UNIGUARD® by Luvata copper alloy tubing to block formicary corrosion All coils utilize aluminum end plates for rust reduction

All coils maintain proper Internal Refrigerant Volumes for heat pump compatibility

All suction and liquid lines placed to air handler access panel location

Line sets pre-swaged, coils shipped with dry nitrogen holding charge 5 year replacement warranty

For printable line art and cross reference utilization chart PDF please visit our website at www.SustainableCoils.com.

Telephone: (903) 881-6006 Fax: (903) 881-6008 email: sales@sustainablecoils.com