




Package Unit Pros
 28302 Industrial Blvd Ste. H
 94545
 (510) 887-2900
 dan@packageunitpros.com

WORK ORDER REPORT

Customer #32

Display name
Customer Type Commercial
Custom Id bal162
Company name
Pricing Tier Tier 1
Description

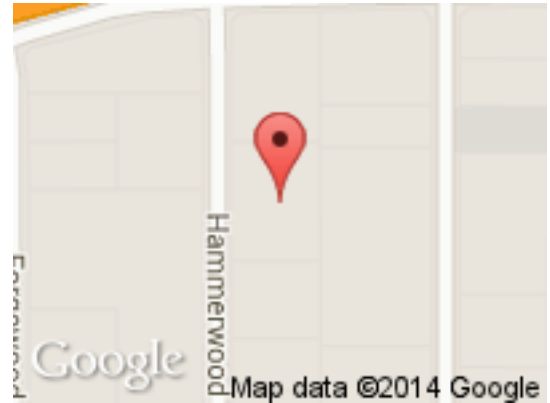

Service : South San Francisco, CA 94080, United States

Address Type Service
Street address
City, State ZIP South San Francisco, CA 94080, United States
Description

Reed Westphal

Contact Type -Not Set-
First name
Last name
Phone
Mobile phone
Wireless Provider -Not Set-
Email address

Service Request #933

Summary
Date Requested 02/28/2014
Description 1st time PM- CHANGE FILTERS
Created 02/28/2014 10:58 AM
Customer

Work Order #933-2-1

Description
Field Worker Vincent Ortega
Status Complete - Billed

Start 03/04/2014 09:30 AM
End 03/04/2014 02:15 PM
Invoicing Memo

 **Service Items**

 **Service Forms**

Write Up-1 To provide information for a quote for repair


Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu 8 suite 107
Make BDP
If Other, Make
Model Number 661cj030-a
Serial Number 4496e19295
Type Number
Type of Unit
If Other, Type
Issue R&R condensing unit
Parts Required Condensing unit
Hours Required
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 9:21 AM.png



Notes

Write Up-2 To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu9 suite 100
Make Carrier
If Other, Make
Model Number 38ycc030300
Serial Number 3100e23342
Type Number
Type of Unit Split System
If Other, Type
Issue Suction line not insulated
Parts Required Insulation
Hours Required 2
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 9:29 AM.png

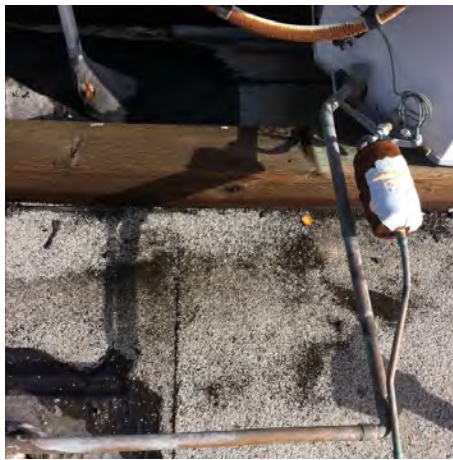

Notes

Write Up-3

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu7 suite 107a
Make Other
If Other, Make Bryant
Model Number 661cj030-a
Serial Number 4299e19996
Type Number
Type of Unit Split System
If Other, Type
Issue Condenser fan not coming on, jumped out pressure control and fan came on. Also suction line insulation torn
Parts Required Pressure control, suction line insulation
Hours Required 4
OT Required?
Unit Age
Tonnage
Rigging
Photo

03/06/14 9:43 AM.png



Notes

Write Up-4

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu6 suite 100
Make Other
If Other, Make Day and night
Model Number 541dj030
Serial Number 1784a30870
Type Number
Type of Unit Split System
If Other, Type
Issue Comp contactor burnt and pitted. Also no suction line insulation.
Parts Required 1p 30a 24v comp contactor, insulation
Hours Required 4
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 9:54 AM.png



Notes

Write Up-5

To provide information for a quote for repair

Customer
Address
Urgent!
Date 03/06/2014
AC Number FA1
Make
If Other, Make
Model Number
Serial Number
Type Number
Type of Unit EF
If Other, Type
Issue Needs new belt
Parts Required A-52
Hours Required
OT Required?
Unit Age
Tonnage
Rigging
Photo
Notes

Write Up-6

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Ac4 suite 203b
Make Carrier
If Other, Make
Model Number 50eza2430
Serial Number 2709c11315
Type Number
Type of Unit Package Unit - Heat Pump
If Other, Type
Issue Contactor pitted and burnt compressor
Parts Required 1p 30a 24v comp contactor
Hours Required
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 10:19 AM.png



Notes

Write Up-7

To provide information for a quote for repair

Customer	
Address	
Urgent!	YES!
Date	03/06/2014
AC Number	Ac5 suite 200
Make	Other
If Other, Make	Day and night
Model Number	Phd360000h000c1
Serial Number	C124048662
Type Number	
Type of Unit	Package Unit - Heat Pump
If Other, Type	
Issue	Not cooling need time to troubleshoot. Possible compressor problem
Parts Required	
Hours Required	2
OT Required?	
Unit Age	
Tonnage	
Rigging	
Photo	
Notes	

Write Up-8

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu5 suite 100
Make BDP
If Other, Make
Model Number 541dj030
Serial Number 1784a30881
Type Number
Type of Unit Split System
If Other, Type
Issue Suction line and compressor are very hot possible restriction.
Need time to troubleshoot
Parts Required
Hours Required 2
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 11:05 AM.png



Notes

Write Up-9

To provide information for a quote for repair

Customer	
Address	
Urgent!	YES!
Date	03/06/2014
AC Number	Cu 4 suite 100
Make	BDP
If Other, Make	
Model Number	541dj030
Serial Number	1784a30862
Type Number	
Type of Unit	Split System
If Other, Type	
Issue	Suspect low on charge. Suction line not getting cold enough.
Parts Required	
Hours Required	1
OT Required?	
Unit Age	
Tonnage	
Rigging	
Photo	
Notes	

Write Up-10

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu2 suite 101a
Make BDP
If Other, Make
Model Number 541du030
Serial Number 784a30893
Type Number
Type of Unit Split System
If Other, Type
Issue Suction line has no insulation. Comp contactor burnt and pitted.
Parts Required 1p 30a 24v contactor. Suction line insulation
Hours Required 3
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 11:24 AM.png




Notes

Write Up-11

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Ac7 suite 202a
Make Carrier
If Other, Make
Model Number 50js060501
Serial Number 0406g21097
Type Number
Type of Unit Package Unit - Heat Pump
If Other, Type
Issue Comp contactor burnt and pitted
Parts Required 2p 30a24v contactor
Hours Required 2
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 11:57 AM.png

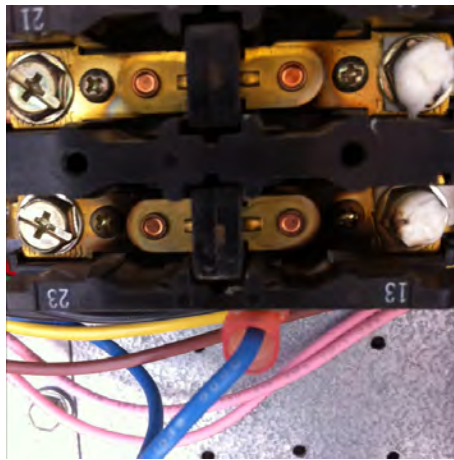

Notes

Write Up-12

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Ac8 suite 202b
Make Carrier
If Other, Make
Model Number 50hjq004521
Serial Number 1807g30649
Type Number
Type of Unit
If Other, Type
Issue No power to unit, need to locate power down below and run ops on unit
Parts Required
Hours Required 2
OT Required?
Unit Age
Tonnage
Rigging
Photo
Notes

Write Up-13

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu1 suite 101b
Make Carrier
If Other, Make
Model Number 38ycb048300
Serial Number 2097e00097
Type Number
Type of Unit Split System
If Other, Type
Issue Unit not cooling. Suspect low on charge need more time to diagnose
Parts Required
Hours Required 1.5
OT Required?
Unit Age
Tonnage
Rigging
Photo
Notes

Write Up-14

To provide information for a quote for repair

Customer
Address
Urgent!
Date 03/06/2014
AC Number Cu3 suite 100
Make Carrier
If Other, Make
Model Number 661cj030-a
Serial Number 4295e12358
Type Number
Type of Unit Split System
If Other, Type
Issue No suction line insulation
Parts Required Insulation
Hours Required 1
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 12:21 PM.png



Notes

Write Up-15

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu2 suite 101b
Make BDP
If Other, Make
Model Number 541dj024
Serial Number 1684a29777
Type Number
Type of Unit Split System
If Other, Type
Issue Compressor making loud noise and not cooling. Need further investigation.
Parts Required
Hours Required 1.5
OT Required?
Unit Age
Tonnage
Rigging
Photo
Notes

Write Up-16

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu3 suite 100
Make BDP
If Other, Make
Model Number 541dj030
Serial Number 3684a51862
Type Number
Type of Unit Split System
If Other, Type
Issue Ac not cooling need to troubleshoot.
Parts Required
Hours Required 1.5
OT Required?
Unit Age
Tonnage
Rigging
Photo
Notes

Write Up-17

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Cu1 suite 101a
Make BDP
If Other, Make
Model Number 541d
Serial Number 1884a32547
Type Number
Type of Unit Split System
If Other, Type
Issue Top off charge, and compressor contactor burnt and pitted. Also suction line is not insulated
Parts Required R-22 amount tbd. 1p 30a24v comp contactor. Suction line insulation 10 feet.
Hours Required 5
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 12:52 PM.png



Notes

Write Up-18

To provide information for a quote for repair

Customer
Address
Urgent! YES!
Date 03/06/2014
AC Number Ac1 suite209, ac2 suite 210, ac4 suite 200, ac5 suite207, ac6 suite200, ac7 suite 203, ac8 suite200, ac9 suite201.
Make Carrier
If Other, Make
Model Number ?
Serial Number ?
Type Number
Type of Unit Package Unit - Heat Pump
If Other, Type
Issue All units except ac3 suite208 have there stat wires ran across the roof from one end to the other end. We need to run stat wires through the plentum. All exposed and ready to short out
Parts Required Stat wire
Hours Required 16
OT Required?
Unit Age
Tonnage
Rigging
Photo 03/06/14 1:21 PM.png



Notes

PM Form

Use to close PM
Inspection Date 03/06/2014
Hours Used 08:00
Location
Filters Changed Yes
Coils Cleaned No
Write Ups to Follow? Yes
Notes
Multiple Day Hour Notes

 **Attachments**