

North/East Roofing Contractors Association

February 7, 2023 Mohegan Sun – Uncasville, CT

NRCA technical issues update



Mark S. Graham

Vice President, Technical Services National Roofing Contractors Association Rosemont, Illinois


1

Topics

- Market conditions
- Update on codes
- Imported plywood and OSB concerns
- Imported lumber concerns
- Synthetic underlayment
 - Water vapor transmission testing
- Ignition temperature research
- Vapor retarder adhesion testing
- Contractor-reported problems
- Questions and other topics

Market conditions

3

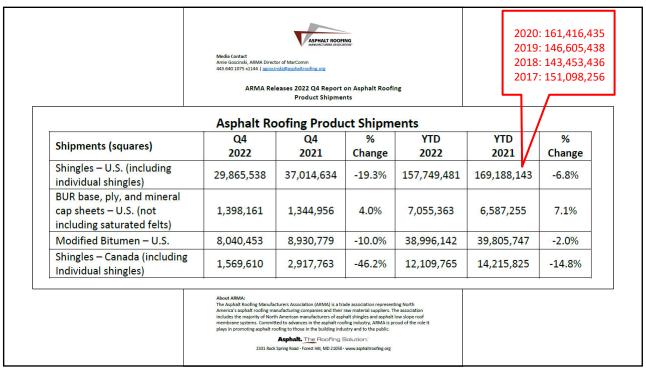



Media Contact Amie Goscinski, ARMA Director of MarComm 443.640.1075 x1144 | agoscinski@asphaltroofing.org

> ARMA Releases 2022 Q4 Report on Asphalt Roofing Product Shipments

Asphalt Roofing Product Shipments						
Shipments (squares)	Q4 2022	Q4 2021	% Change	YTD 2022	YTD 2021	% Change
Shingles – U.S. (including individual shingles)	29,865,538	37,014,634	-19.3%	157,749,481	169,188,143	-6.8%
BUR base, ply, and mineral cap sheets – U.S. (not including saturated felts)	1,398,161	1,344,956	4.0%	7,055,363	6,587,255	7.1%
Modified Bitumen – U.S.	8,040,453	8,930,779	-10.0%	38,996,142	39,805,747	-2.0%
Shingles – Canada (including Individual shingles)	1,569,610	2,917,763	-46.2%	12,109,765	14,215,825	-14.8%

About ARMA:

The Asphalt Roofing Manufacturers Association (ARMA) is a trade association representing North
America's asphalt roofing manufacturing companies and their raw material suppliers. The association
includes the majority of North American manufacturers of asphalt shingles and asphalt tow slope roof
membrane systems. Committed to advances in the asphalt roofing industry, adMail is ground of the role it
plays in promoting asphalt roofing to those in the building industry and to the public.

Asphalt. The Roofing Solution.'

2331 Rock Spring Road • Forest Hill, MD 21050 • www.asphaltroofing.org

5



Amie Goscinski, ARMA Director of MarComm
443.640.1075 x1144 | agoscinski@asphaltroofing.or


ARMA Releases 2022 Q4 Report on Asphalt Roofing Product Shipments

Asphalt Roofing Product Shipments						
Shipments (squares)	Q4 2022	Q4 2021	% Change	YTD 2022	YTD 2021	% Change
Shingles – U.S. (including individual shingles)	29,865,538	37,014,634	-19.3%	157,749,481	169,188,143	-6.8%
BUR base, ply, and mineral cap sheets – U.S. (not including saturated felts)	1,398,161	1,344,956	4.0%	7,055,363	6,587,255	7.1%
Modified Bitumen – U.S.	8,040,453	8,930,779	-10.0%	38,996,142	39,805,747	-2.0%
Shingles – Canada (including Individual shingles)	1,569,610	2,917,763	-46.2%	12,109,765	14,215,825	-14.8%

About ARMA:
The Aphild Roofing Manufacturers Association (ARMA) is a trade association representing North
America's asphalt roofing manufacturing companies and their raw material suppliers. The association
includes the majority of North American manufacturers of asphalt shingles and asphalt low slope roof
membrane systems. Committed to advances in the asphalt or roofing industry, adMAs is proud of the role it
plays in promoting asphalt roofing to those in the building industry and to the public.


Asphalt. The Roofing Solution.'

2331 Rock Spring Road · Forest Hill, MD 21050 · www.asphaltroofing.org

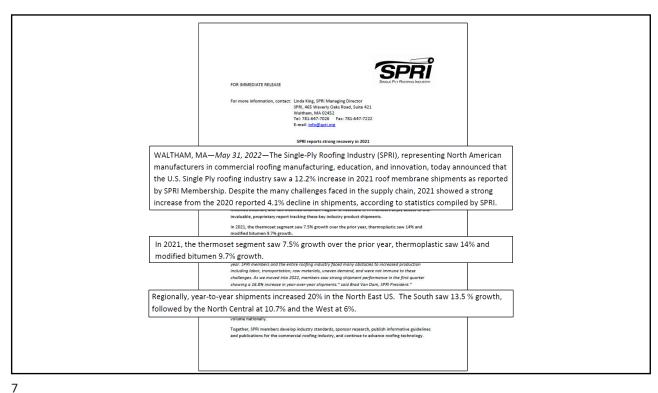



What to expect in 2023
9
<u>Update on codes</u>

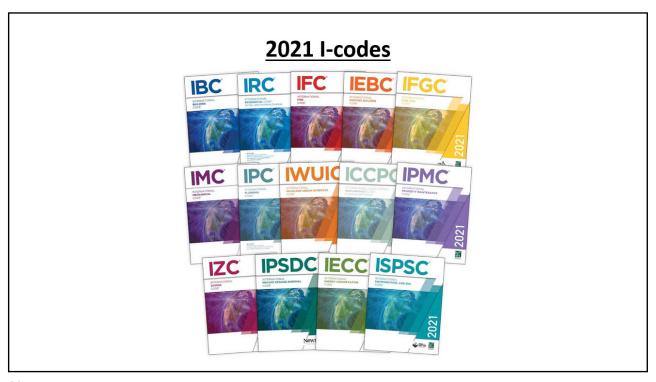

Roofing-related change in the 2021 I-codes





2024 I-codes

- Development of 2024 I-codes complete, except 2024 IECC
 - Q3 2023 publication planned, except 2024 IECC

15

State of Massachusetts — Hot work permits If No infloat mediate of the Commonwealth of Massachusetts is made have you been as a first of the Commonwealth of Massachusetts is made have you been as a first of the Commonwealth of Massachusetts is made and the Commonwealth of Massachusetts. Mass good in a commonwealth of Massachusetts in MA prof 179.83 NB LART UPPARTED: 2018-07-16 LINGUAGE: English CONTRIBUTING ORGANIZATION Department of Fire Services All Topics Site Policies Public Records Requests 6.2022 Commonwealth of Massachusetts. Mass good in a registered service most of the Commonwealth of Massachusetts. Mass good in a registered service most of the Commonwealth of Massachusetts. Link Link

What are the additional duties of a ho work fire watch? The fire watch must review and ensure the internal hot work permit is completed and posted. The fire watch must also remain on site for at lea 30 minutes after the completion of all ho work.

Is an AHJ permit always required? No There are few exceptions where an AHJ permit is not required.

Homeowners and hobbyists conducting work are exempt from both training and permit requirements.

Individuals who conduct hot work operations on their premise or equipme shall be permitted to carry-out hot work after consultation with the AHJ before h work operations can be conducted.

When the hot work activity is performed a person, or under the direct supervision a person, licensed and permitted pursua to a specialized code as defined in M.G.I. 143, §96 (ex. licensed plumbers, electricis sheet metal workers, etc).

When the local fire and building officials have already pre-approved the location designated area.

What is the state fire code in Massachusetts? The state fire code is known as the Massachusetts
Comprehensive Fire Safety Code, 527
CMR 1.00. Visit www.mass. gov/dfs and search for 527 CMR 1. The state fire code adopts NFPA 1 (2015 Edition), and includes Massachusetts amendments. Within the code are the appropriate editions of NFPA standards that must be met.

Where can the requirements for hot works be found within the state fire code? These requirements are found in Chapter 41. This section adopts NFPA 51B – Standard for Fire Prevention During Welding, Cutting, and Other Hot Work (2014 Edition), which also includes Massachusetts amendments.

Do the personnel involved in hot work need to be trained? As of July 1, 2018, for an individual to be qualified to be a PAI, perform fire watches, perform, supervise or delegate any activities of hot work they shall have documentation that he or she has successfully completed training approved by the State Fire Marshal.

Welding, Cutting, and Other Hot Work





Fire Safety Requirements in Massachusetts



17

Imported lumber concerns

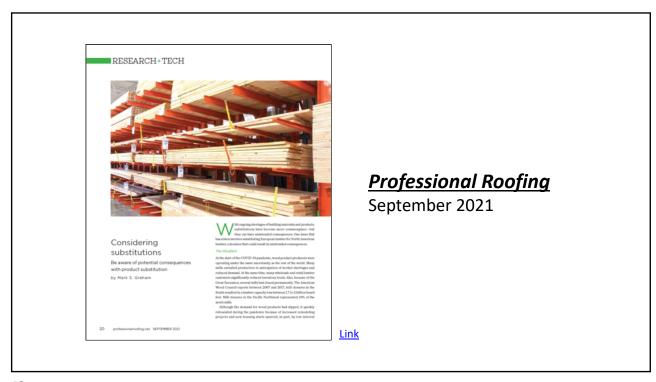

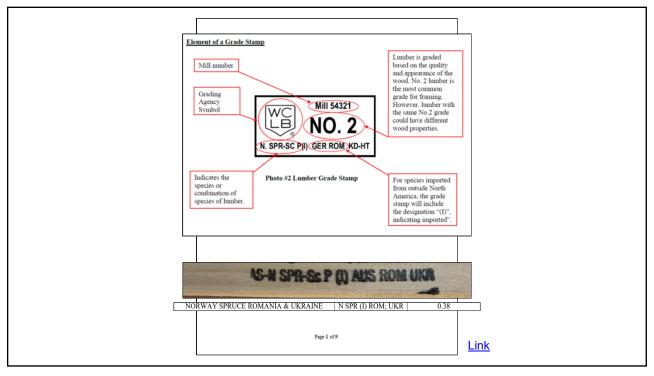

Imported plywood and OBS concerns

21

Standards for wood structural panels

International Residential Code, 2018 Edition


Plywood:

- U.S. Department of Commerce PS-1, "Structural Plywood"
- CSA Group O325, "Construction Sheathing"

Oriented-strand board (OSB):

- U.S. Department of Commerce PS-2, "Performance Standard for Wood-based Structural-use Panels"
- CSA Group O437, "Standards for OSB and Waferboard"



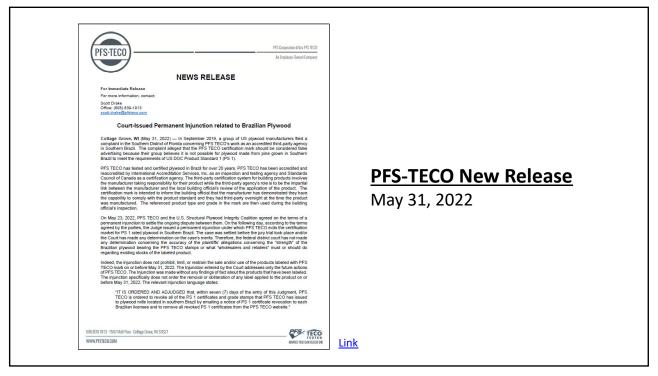

Conclusions and recommendations Concerns with imported lumber and plywood and OSB sheathing

- Be cautious of newly-installed lumber and plywood and OSB
- You may want to check grade stamps
- Roof deck acceptance should be limited
- Prepare yourself for more roof deck replacement

25

Synthetic underlayment




If use of a nonasphaltic or synthetic underlayment product is being considered for a specific project, code acceptance can be sought by making a specific request to the authority having jurisdiction (AHJ). AHJs typically will request an evaluation report, such as those provided by ICC Evaluation Service or Underwriters Laboratories Inc. AHJs may grant code acceptance for alternative underlayment products on a project-by-project basis and typically not a blanket acceptance applying to all future projects in a specific jurisdiction.

Professional RoofingDecember 2016

Link


27

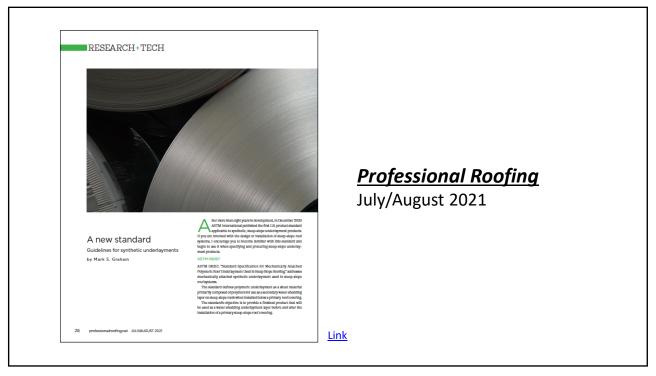





ASTM D8257, "Standard Specification for Mechanically Attached Polymeric Roof Underlayment Used in Steep Slope Roofing"

Published in December 2020

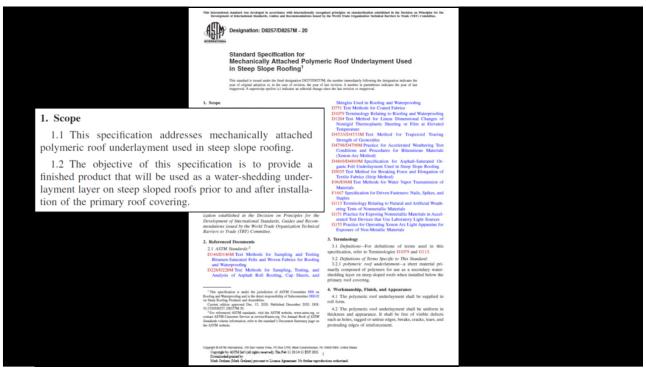

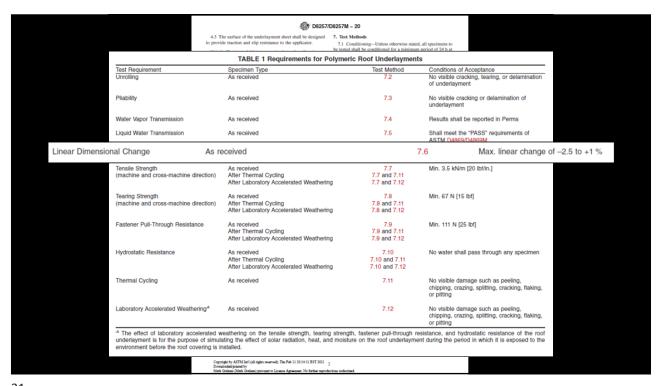

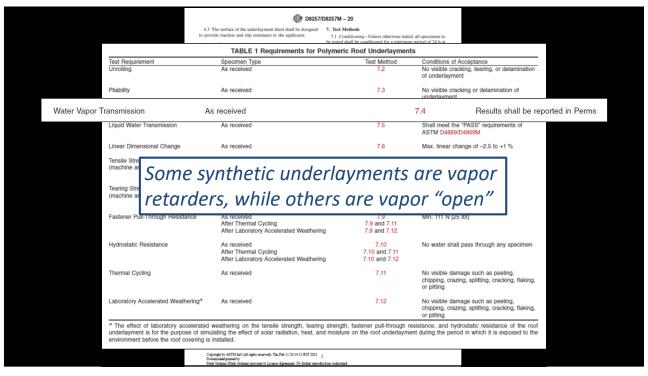


Measurement of a vapor retarder's effectiveness

Classification	Permeance ¹	
Class I vapor retarder	0.1 perm or less	
Class II vapor retarder	1.0 perm or less and greater than 0.1 perm	
Class III vapor retarder	10 perm or less and greater than 1.0 perm	
¹ Permeance determined according to ASTM E-96 Test Method A (


¹ Permeance determined according to ASTM E-96 Test Method A (the desiccant method or dry cup method)

33

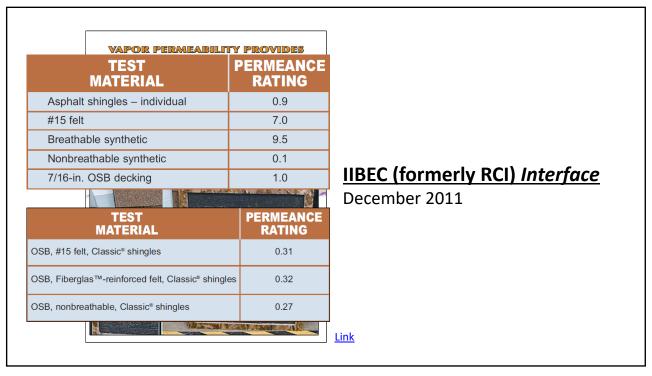



ASTM E96, "Standard Test Methods for Gravimetric Determination of Water Vapor Transmission Rate of Materials"

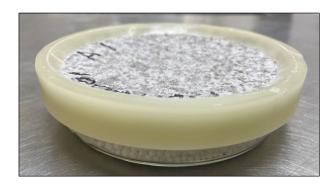

35

ASTM E96 Procedure A results

NRCA permeance testing of asphalt shingle roof assemblies

Sample	Water vapor permeance (Perms)		
7/16" OSB sheathing	1.4		
15/32" CDX plywood sheathing	0.9		

ASTM E96 Procedure A results -- continued

NRCA permeance testing of asphalt shingle roof assemblies

Sample	Water vapor permeance (Perms)
Non-breathable synthetic underlayment	0.02
Breathable synthetic underlayment	0.5

37

ASTM E96 Procedure A results -- continued

NRCA permeance testing of asphalt shingle roof assemblies

Sample	Water vapor permeance (Perms)
Non-breathable synthetic underlayment over 7/16" OSB sheathing	0.03
Non-breathable synthetic underlayment over 15/32" CDX plywood sheathing	0.05
Breathable synthetic underlayment over 7/16" OSB sheathing	0.50
Breathable synthetic underlayment over 15/32" CDX plywood sheathing	0.22

ASTM E96 Procedure A results -- continued

NRCA permeance testing of asphalt shingle roof assemblies

Sample	Water vapor permeance (Perms)
Laminated asphalt shingle over non-breathable synthetic underlayment over 7/16" OSB sheathing	0.05
Laminated asphalt shingle over non-breathable synthetic underlayment over 15/32" CDX plywood sheathing	0.04
Laminated asphalt shingle over breathable synthetic underlayment over 7/16" OSB sheathing	0.40
Laminated asphalt shingle over breathable synthetic underlayment over 15/32" CDX plywood sheathing	0.09

39

ASTM E96 Procedure A results -- continued

NRCA permeance testing of asphalt shingle roof assemblies


Sample	Water vapor permeance (Perms)
Laminated asphalt shingle over non-breathable synthetic underlayment	0.05
over 7/16" OSB sheathing	0.10 with nail
Laminated asphalt shingle over non-breathable synthetic underlayment	0.04
over 15/32" CDX plywood sheathing	0.10 with nail
Laminated asphalt shingle over breathable synthetic underlayment	0.40
over 7/16" OSB sheathing	0.50 with nail
Laminated asphalt shingle over	0.09
breathable synthetic underlayment	
over 15/32" CDX plywood sheathing	0.18 with nail


"Preliminary" conclusions NRCA permeance testing of asphalt shingle roof assemblies

- There is a potential for condensation development at the roof deck level when using synthetic underlayment
- Functional below-deck ventilation is (even more) important for mitigating condensation development at the roof deck level when using synthetic underlayment

41

MRCA/NRCA ignition temperature research

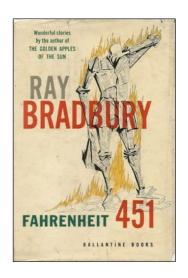

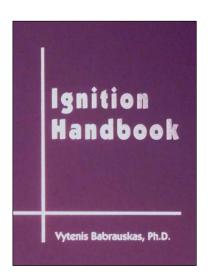

Some known roof application temperatures

Mopping bitumen:

• EVT: 375 F to 455 F (typ.)

• Flash point: 525 F (min.)


Hot-air welding:

• Equipment settings up to 600 C (1,112 F)

Torch application:

• Blue flame: 3,596 F

• Yellow/orange flame: 1,800 F

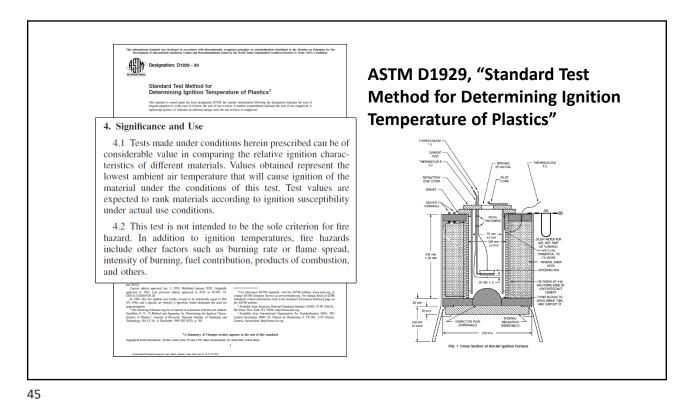

<u>- 10 1111 </u>				
Sample	Test result			
Extruded polystyrene	865 F			
HD polyiso with glass facer	865 F			
Wood fiberboard	875 F			
Polyiso with coated glass facer	895 F			
Perlite board	905 F			
Expanded polystyrene	910 F			
Polyiso with cellulose/glass facer	920 F			
Cellular glass with facer	965 F			
Mineral fiber board	1,040 F			
Gypsum-fiber board	Greater than 1,740 F			
Gypsum board with coated fiberglass facer	Greater than 1,740 F			
Cellular glass (no facer)	Greater than 1,740 F			


ASTM D1929 results

Recommendations

- When hot-air welding or torching roofing products, realize the relative differences in ignition temperatures of various insulation substrates
- Share this information/concept with field workers

47

Vapor retarder adhesion testing Moisture-related issues with concrete roof decks

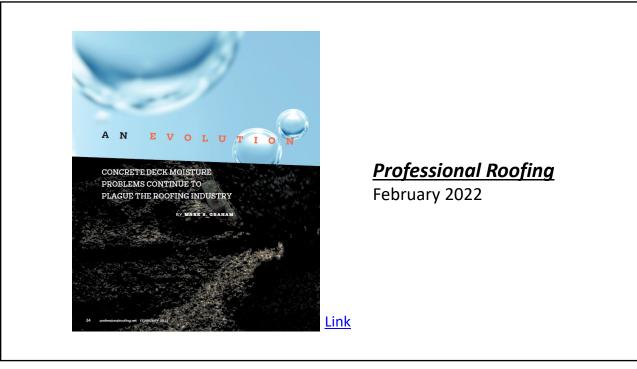

NRCA recommends designers specify and adhered vapor retarder... but isn't adhesion of the vapor retarder a concern?

What we tested Vapor retarder adhesion testing

- 2-ply asphalt BUR membrane
- Manufacturer A-SA vapor retarder
- Manufacturer B-SA vapor retarder
- Manufacturer C-SA vapor retarder
- Manufacturer D-SA vapor retarder

51



Sample conditioning

After vapor retarder application

- Conditioned for 60-days
- One set of each at standard laboratory conditions
- Other set of each at a 30 F temperature differential
 - The temperature differential creates an upward vapor pressure drive







Test results

Vapor retarder adhesion

Sample	Tested pull	Difference		
	Lab. conditions 60-day conditioning (Average of 5 specimens) Vapor drive 60-day conditioning (Average of 5 specimens)		Differential	Percent differential
2-ply built-up membrane	1,421 psf	833 psf	-588 psf	-41%

55

Conclusions

Vapor retarder adhesion

- Results vary
- For 4 of 5 samples, vapor drive conditioning resulted in lower values, but Manufacture 3-SA VR is higher
- All results greater than 90 psf (i.e., FM 1-90)

<u>"Preliminary" recommendations</u> Vapor retarder adhesion

- Designers should specify vapor retarders after considering vapor retarder adhesion both at the time of application and inservice.
- Manufacturers should incorporate some form of vapor drive conditioning assessment in their product development and assessment and make that information available to specifiers.
- The vapor drive conditioning used in this testing is one possible assessment method.

57

Contractors' recently-reported problems

