




T:\Projects\Structural\2016\16BRW015 - RADHA KRISHNA TEMPLE\Revit\16BRW015 - Central R15 (RESTLDC).rvt  
9/15/2016 3:43:06 PM

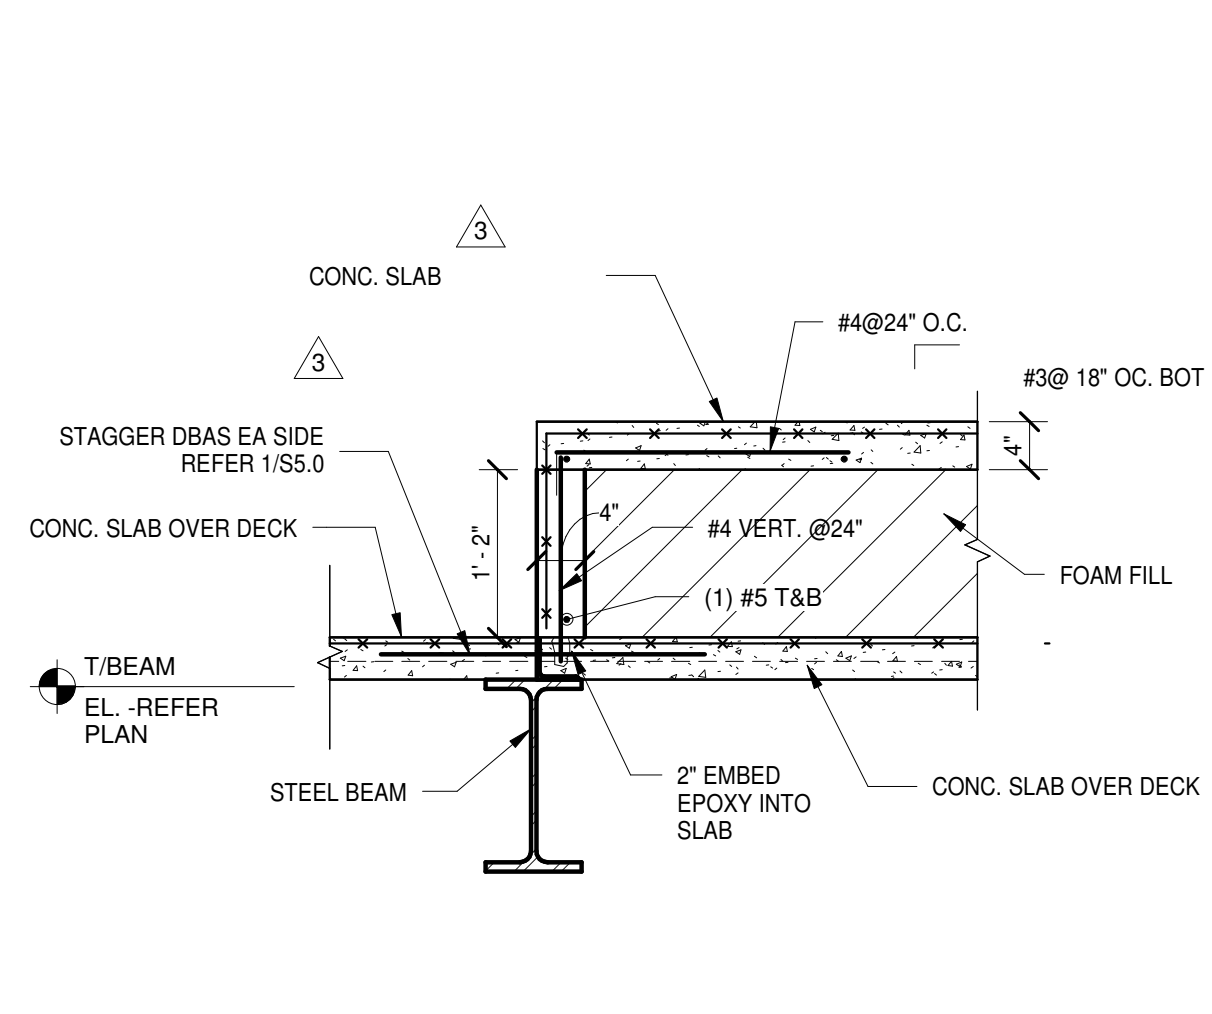


4 SECTION  
S5.0 3/4" = 1'-0"

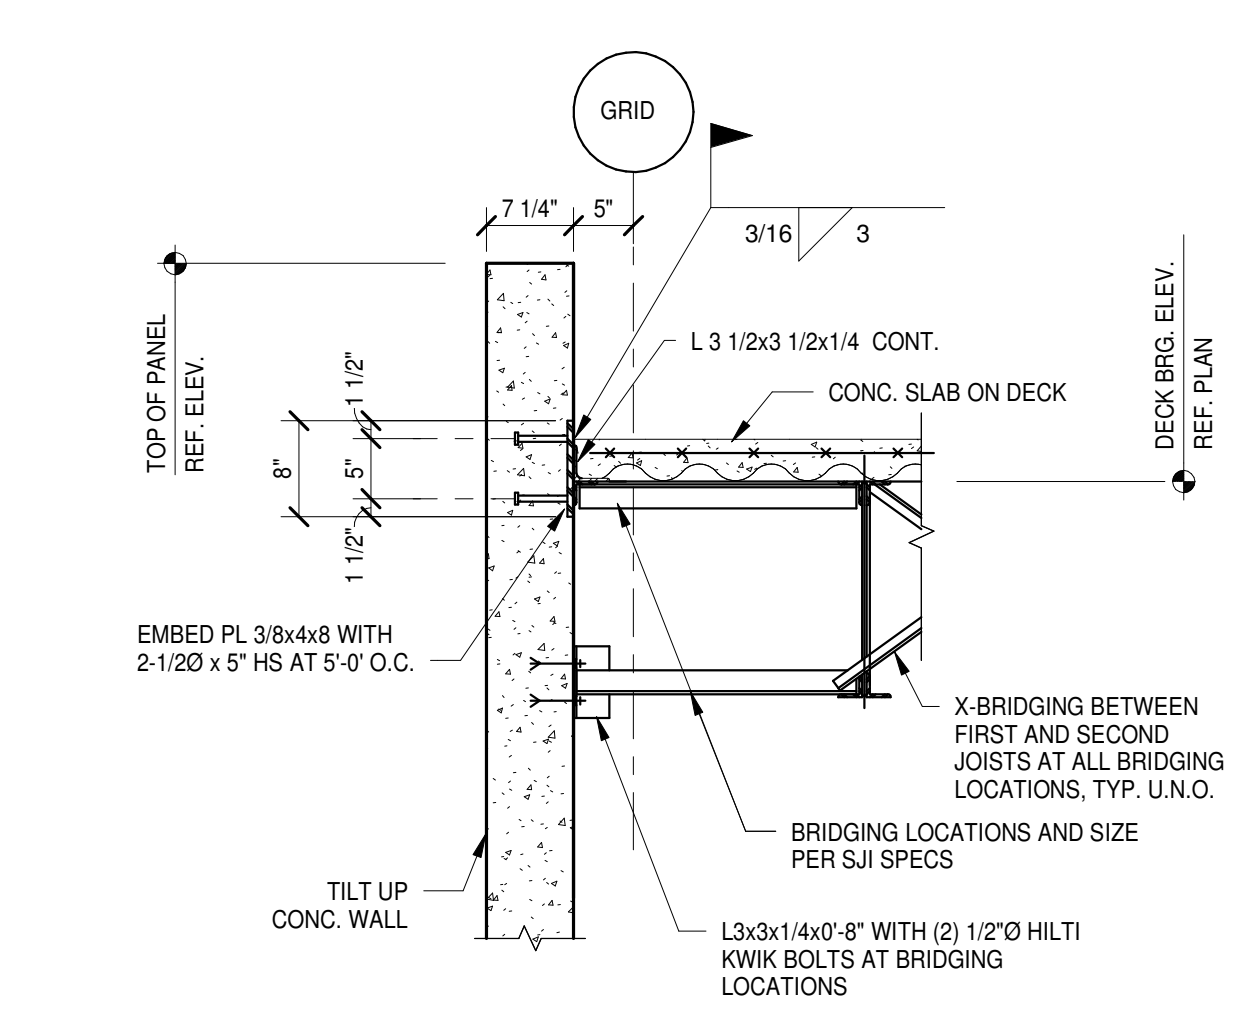


3 SECTION AT 2ND FLOOR  
S5.0 3/4" = 1'-0"

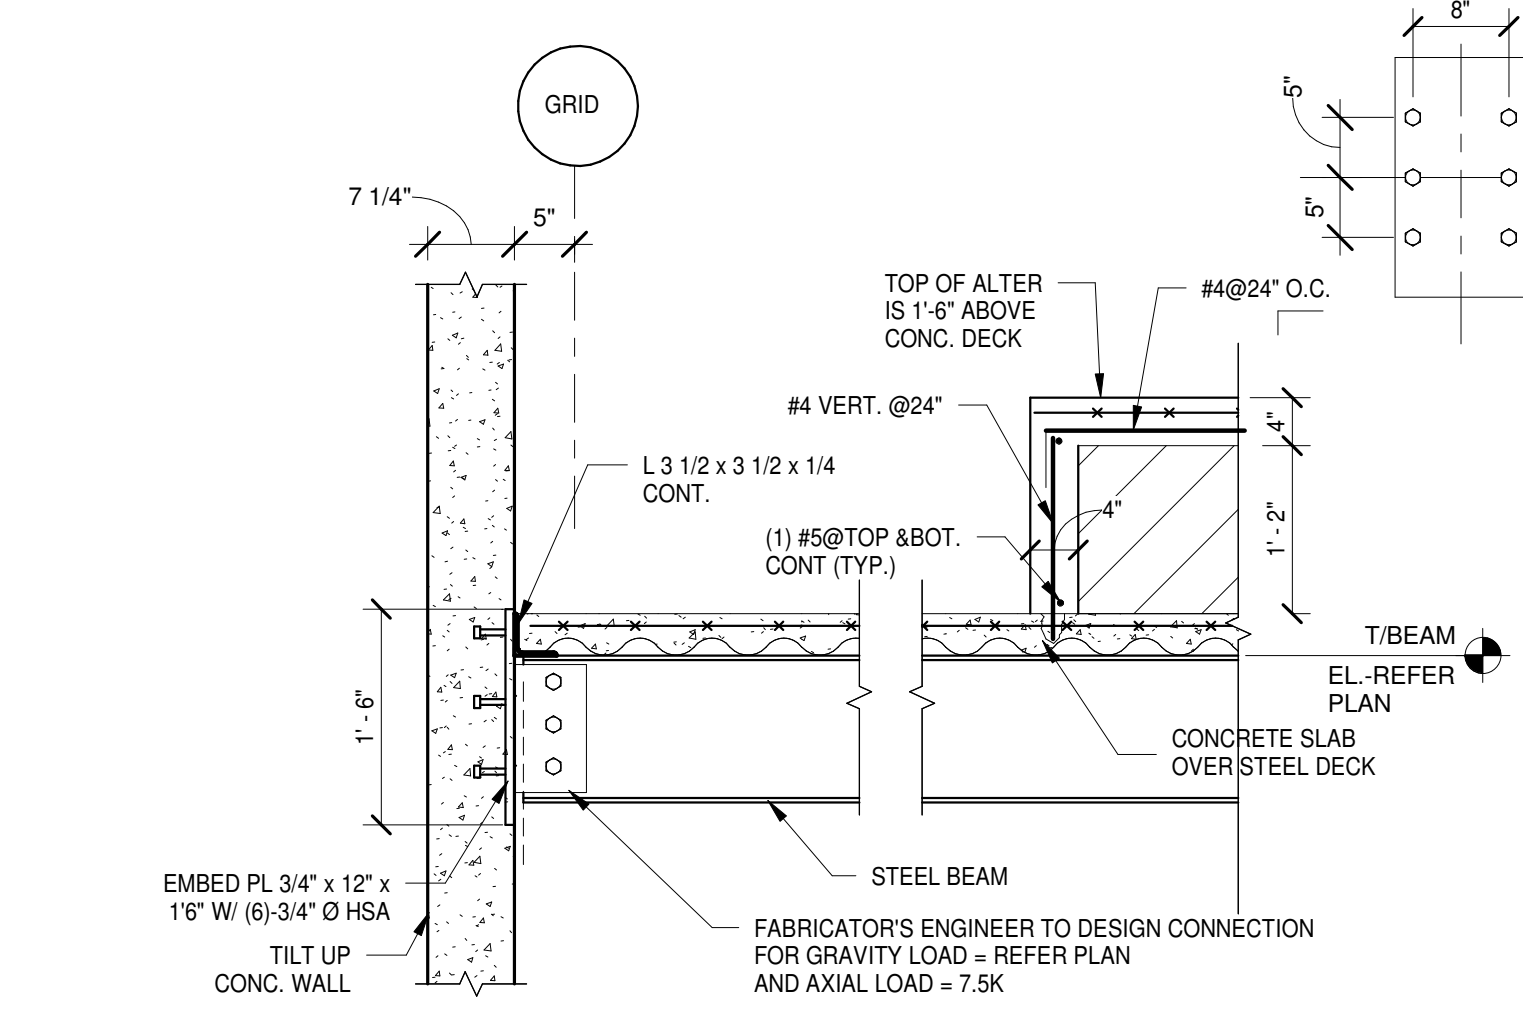


2 BEAM BEARING SECTION AT 2ND FLOOR  
S5.0 3/4" = 1'-0"

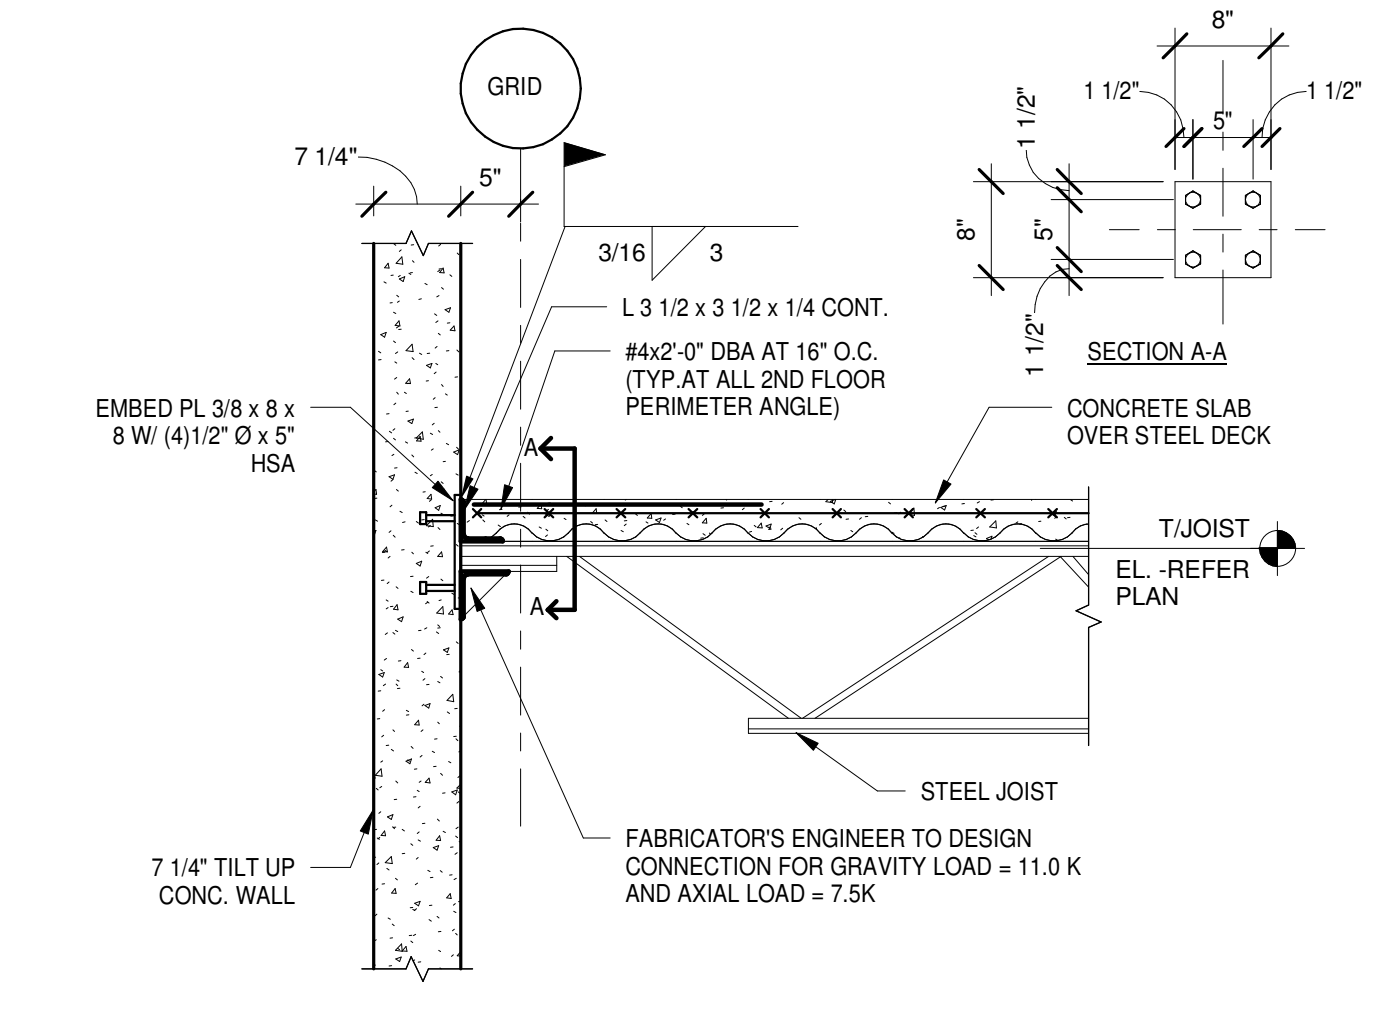


1 SECTION @ 2ND FLOOR  
S5.0 3/4" = 1'-0"

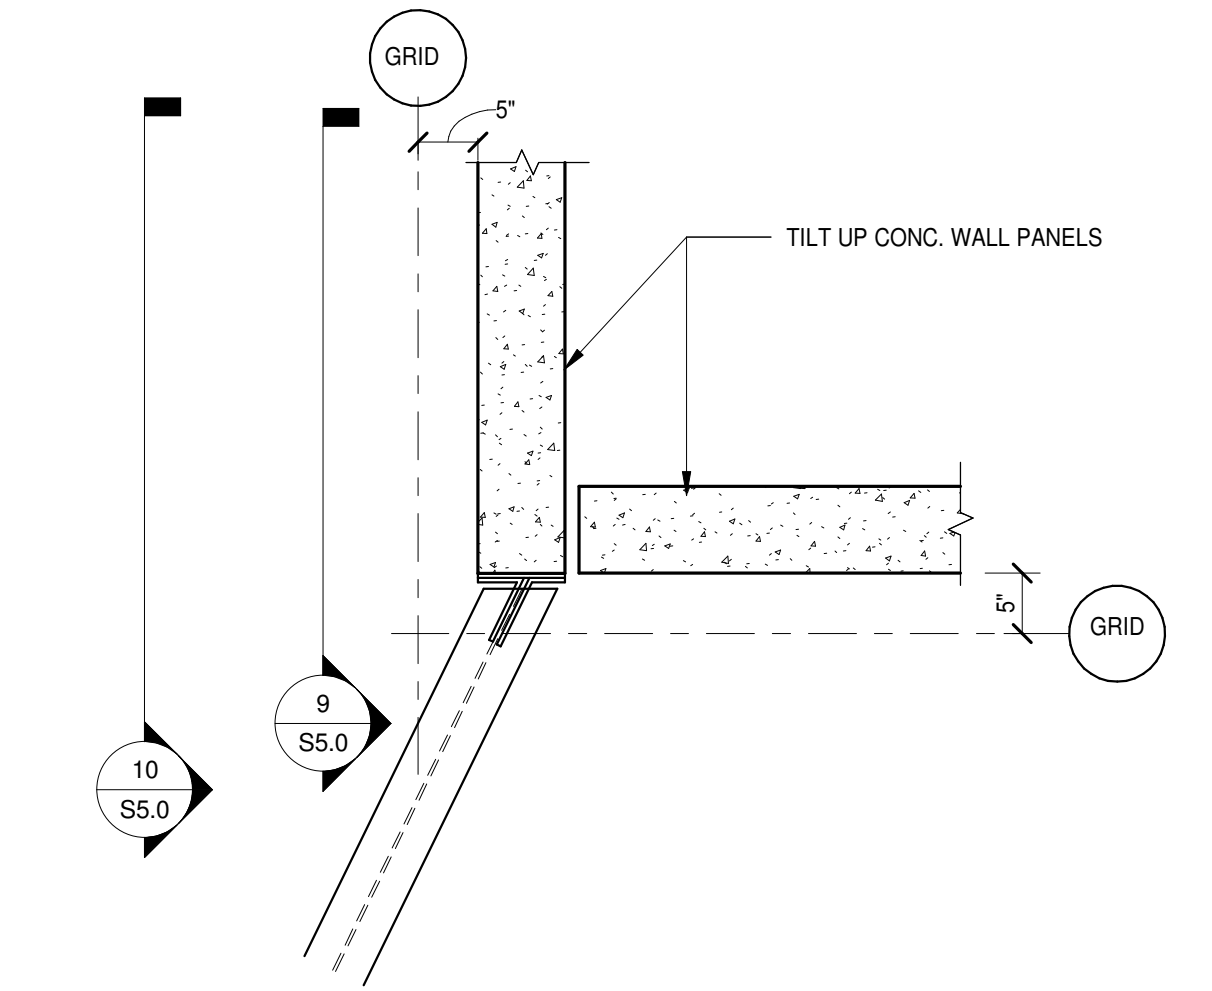


8 DETAIL  
S5.0 3/4" = 1'-0"

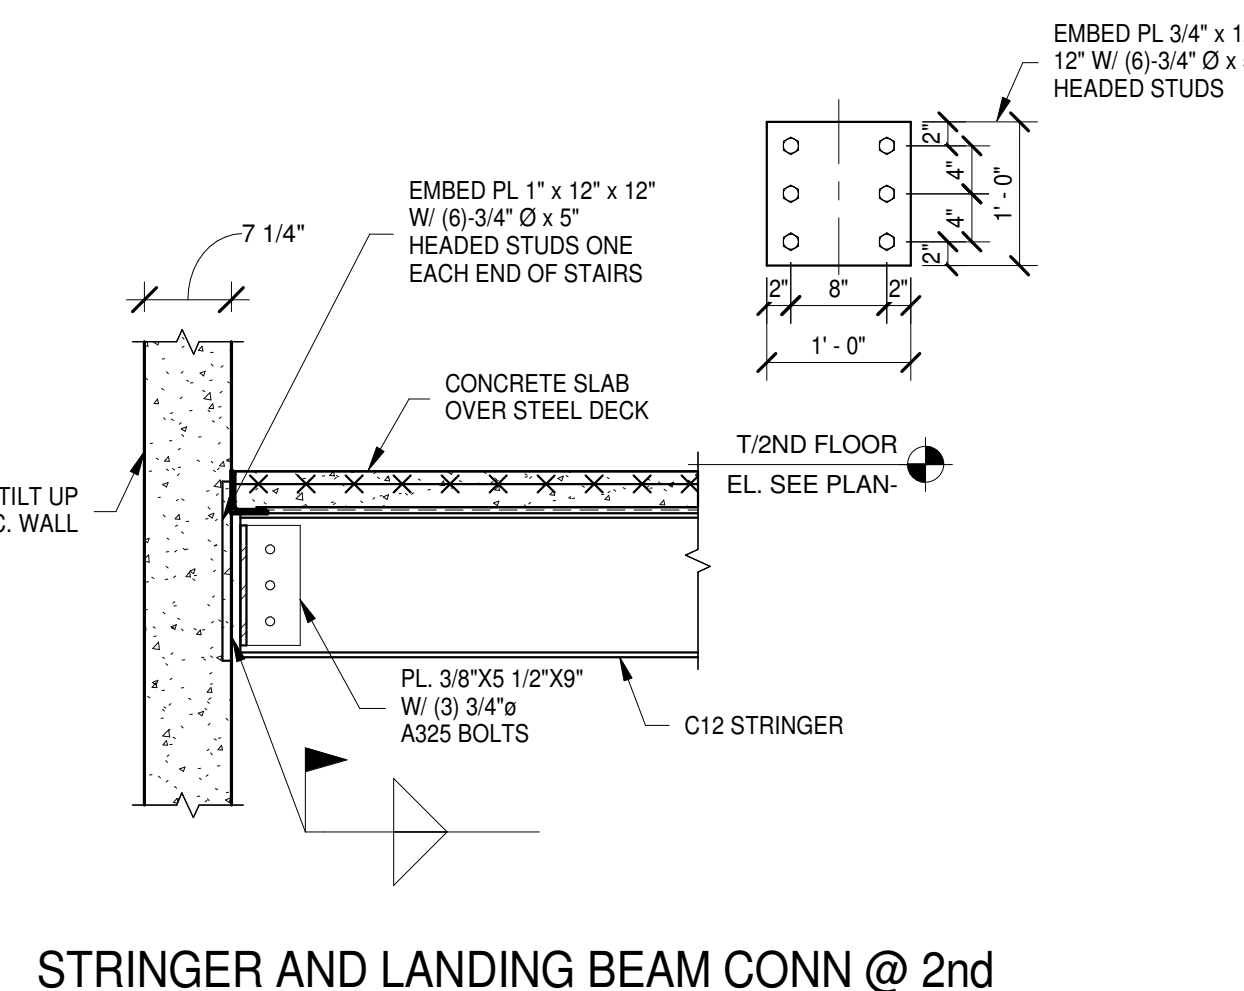


7 STRINGER AND LANDING BEAM CONN @ 2nd FLOOR  
S5.0 3/4" = 1'-0"

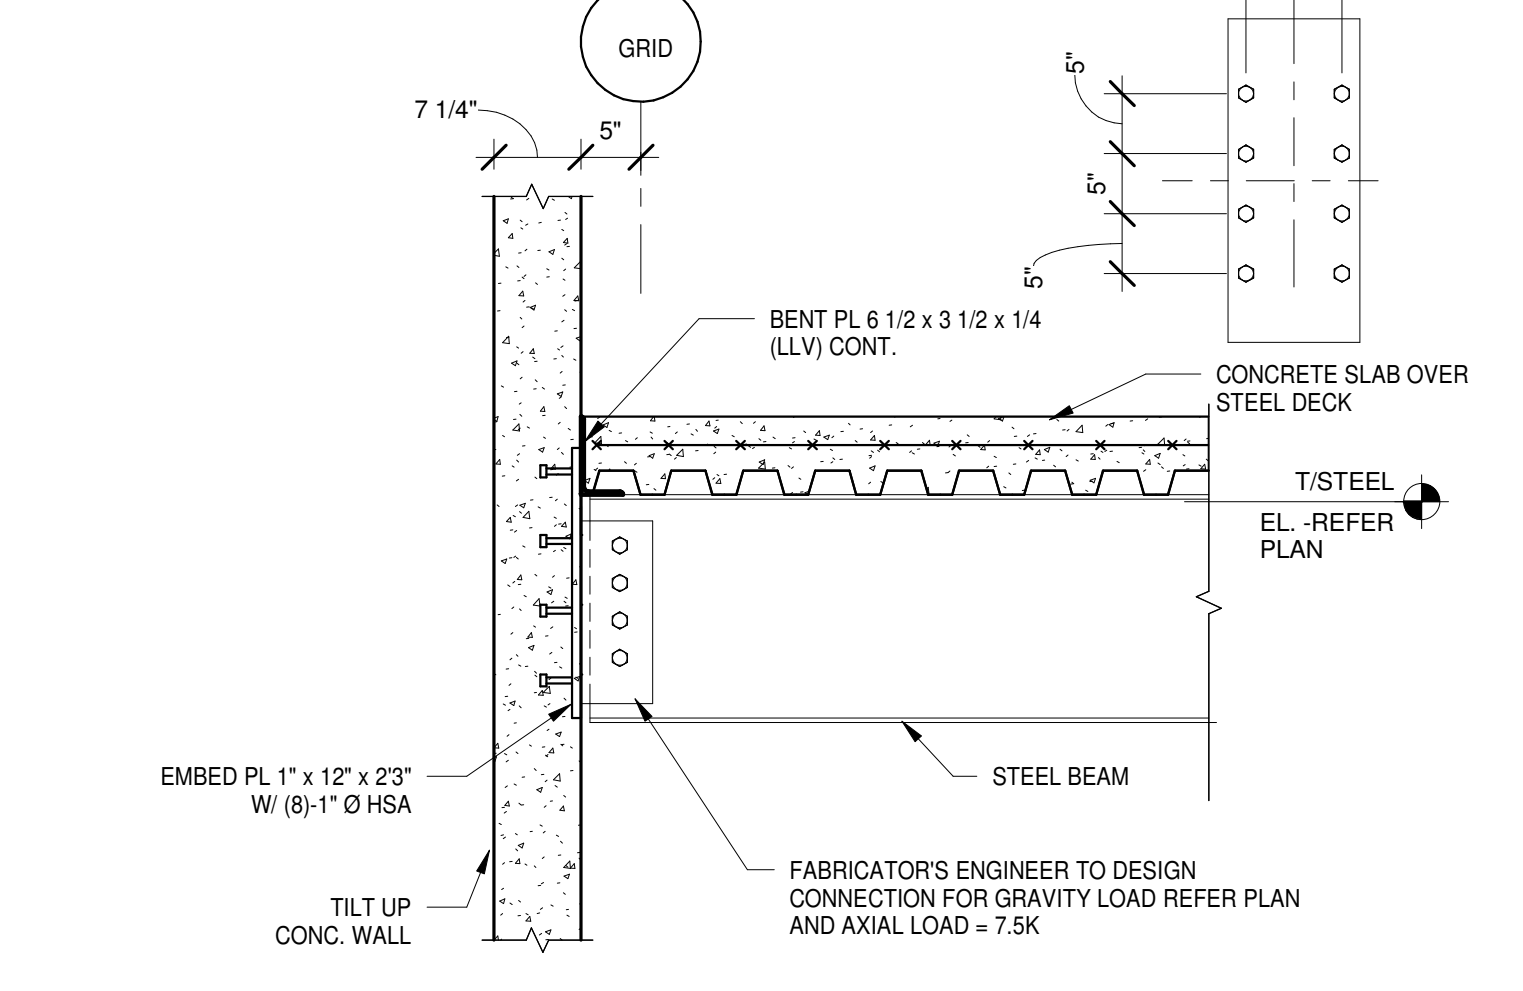


6 BEAM BEARING SECTION @ 2nd FLOOR  
S5.0 3/4" = 1'-0"

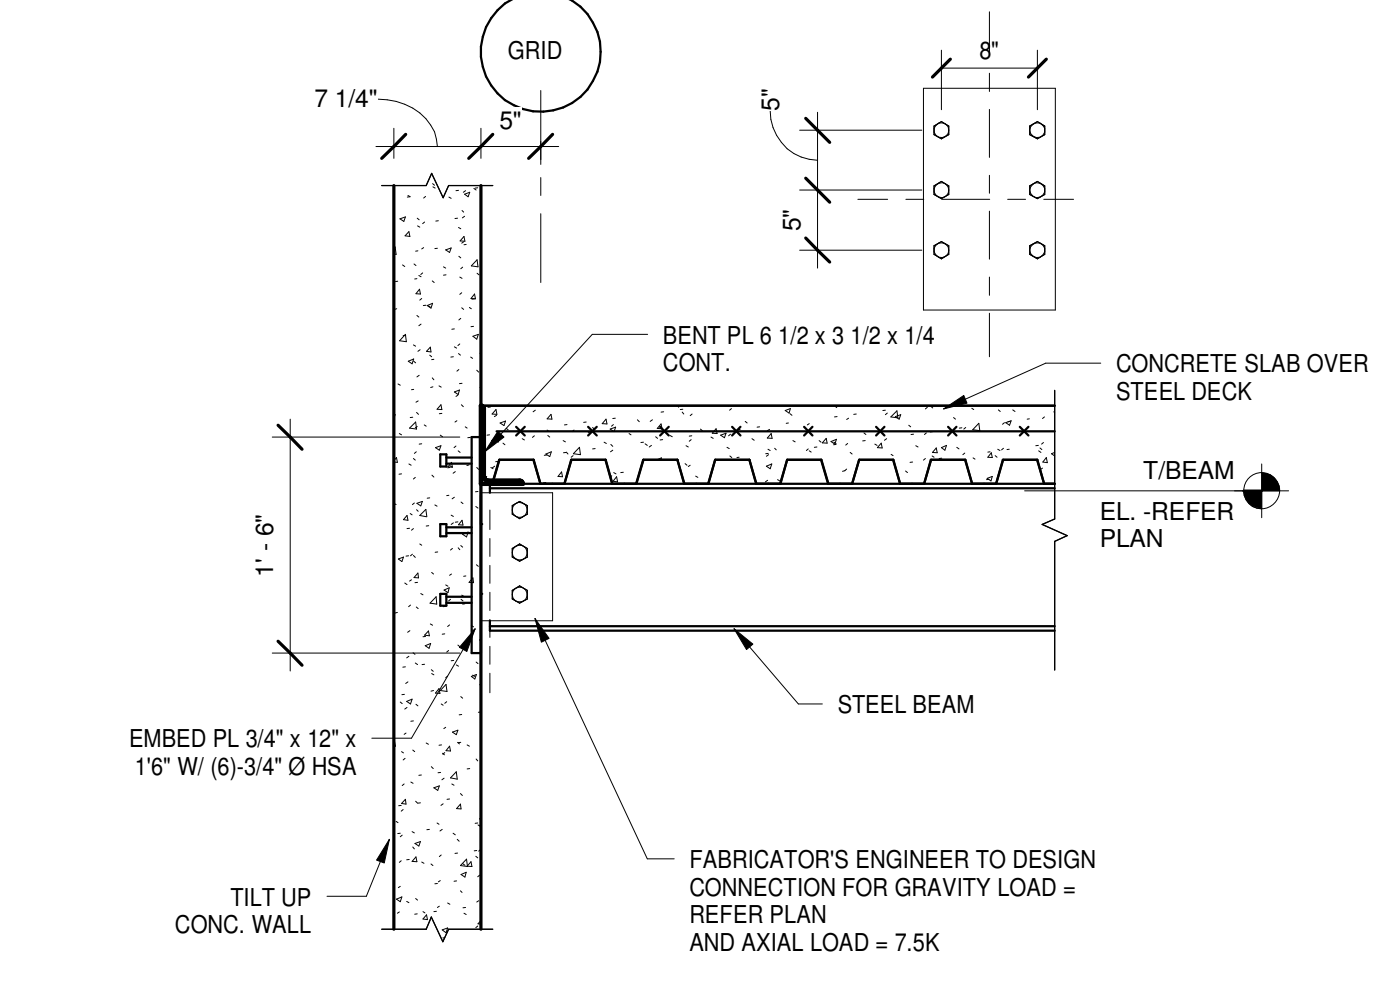


5 BEAM BEARING SECTION AT 2ND FLOOR  
S5.0 3/4" = 1'-0"

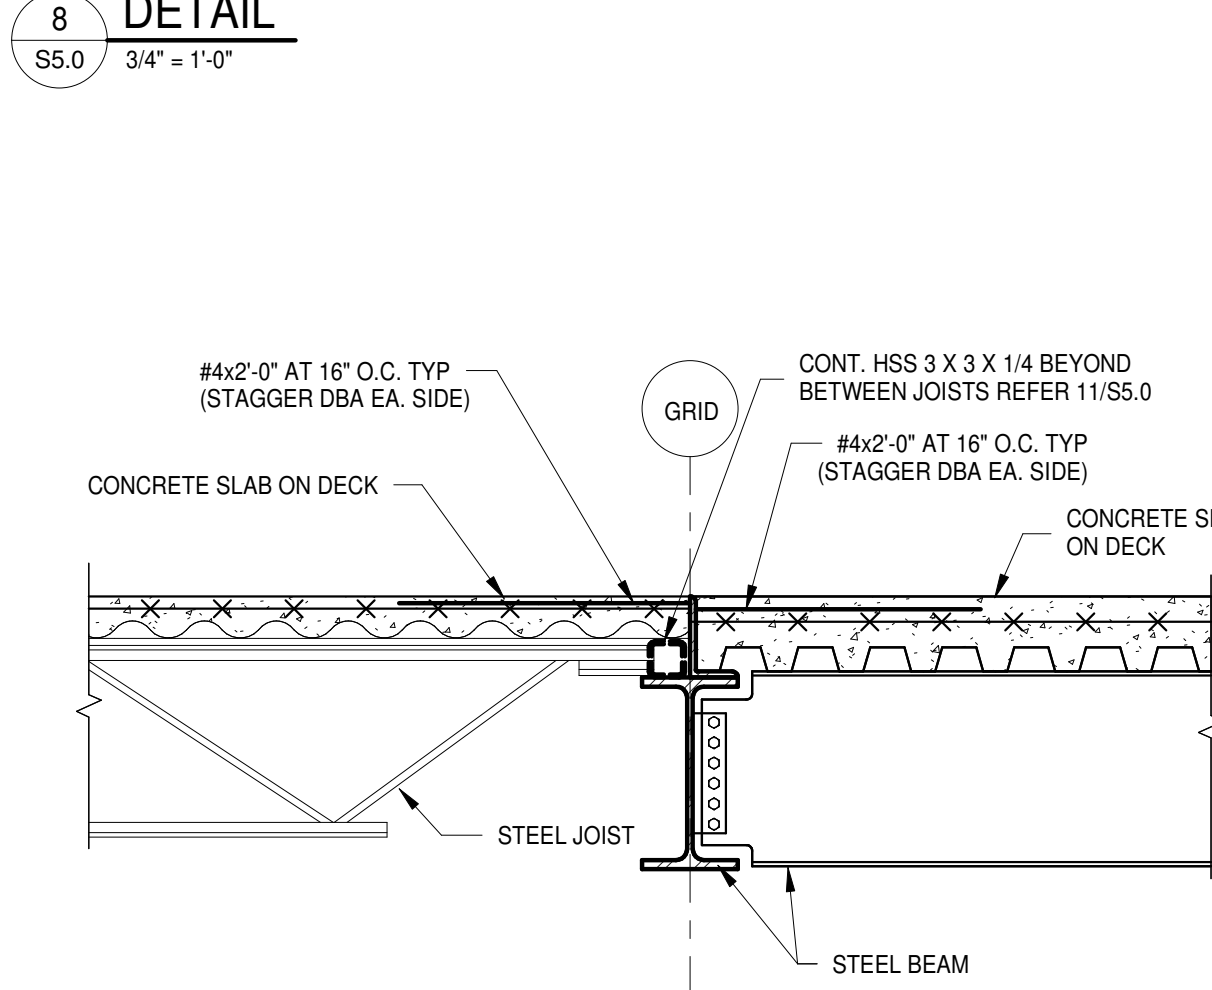


12 SECTION AT DECK TRANSITION  
S5.0 3/4" = 1'-0"

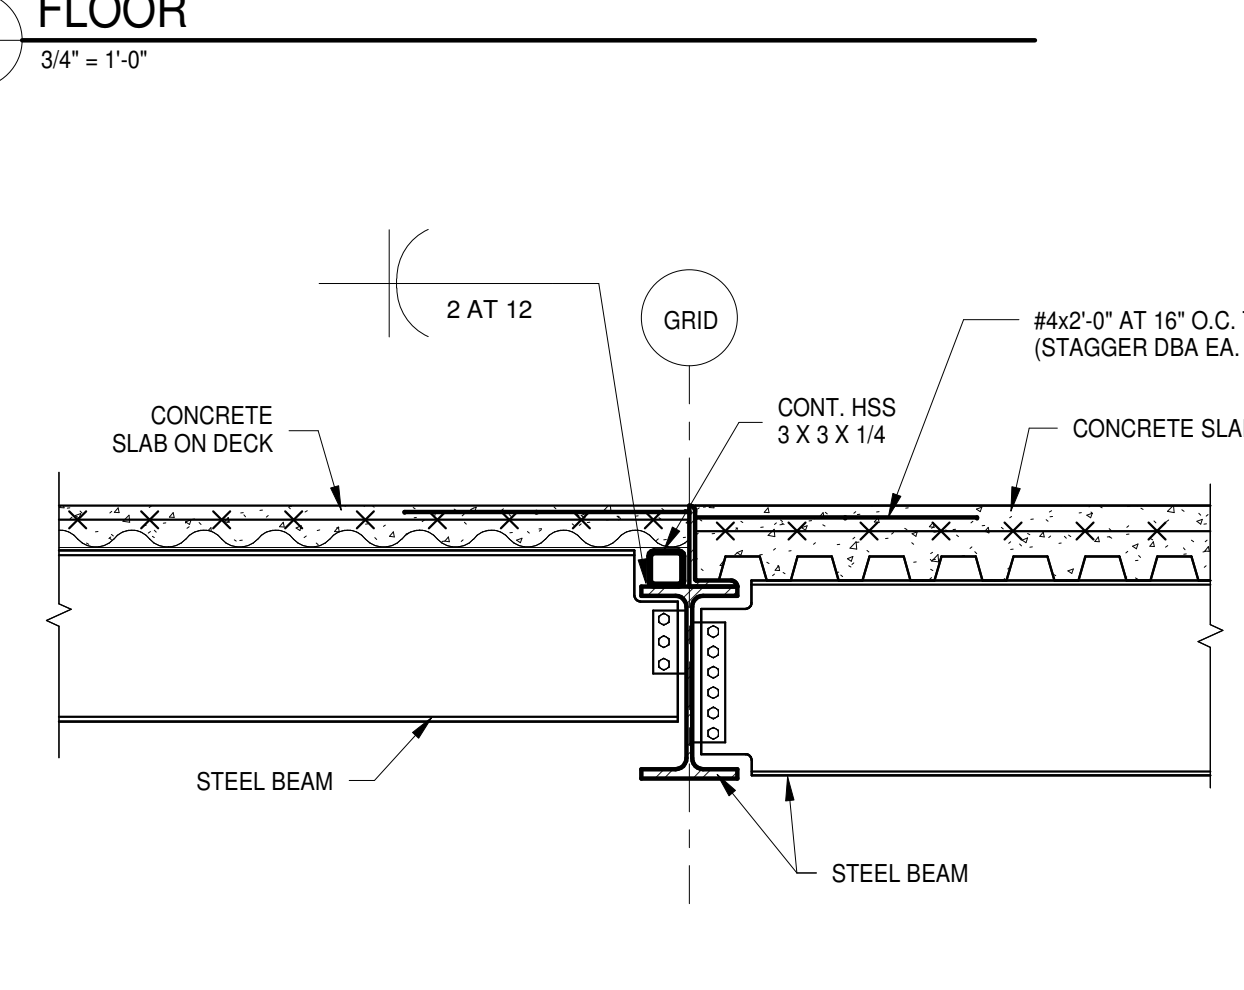


11 SECTION AT DECK TRANSITION.  
S5.0 3/4" = 1'-0"

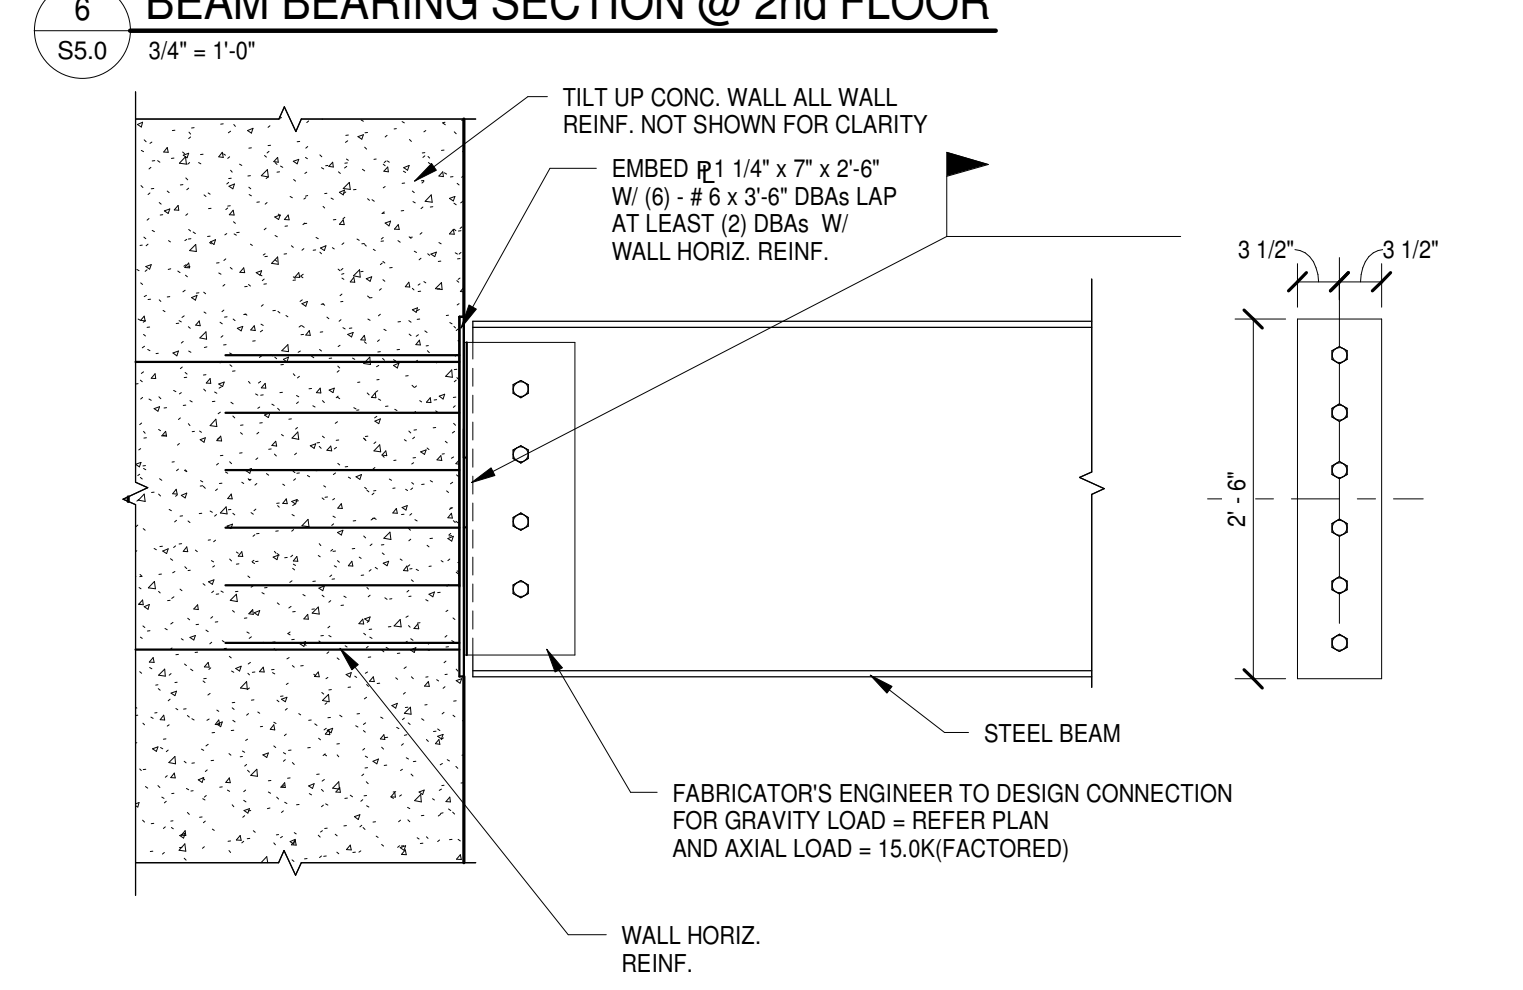


10 SECTION AT ROOF  
S5.0 3/4" = 1'-0"

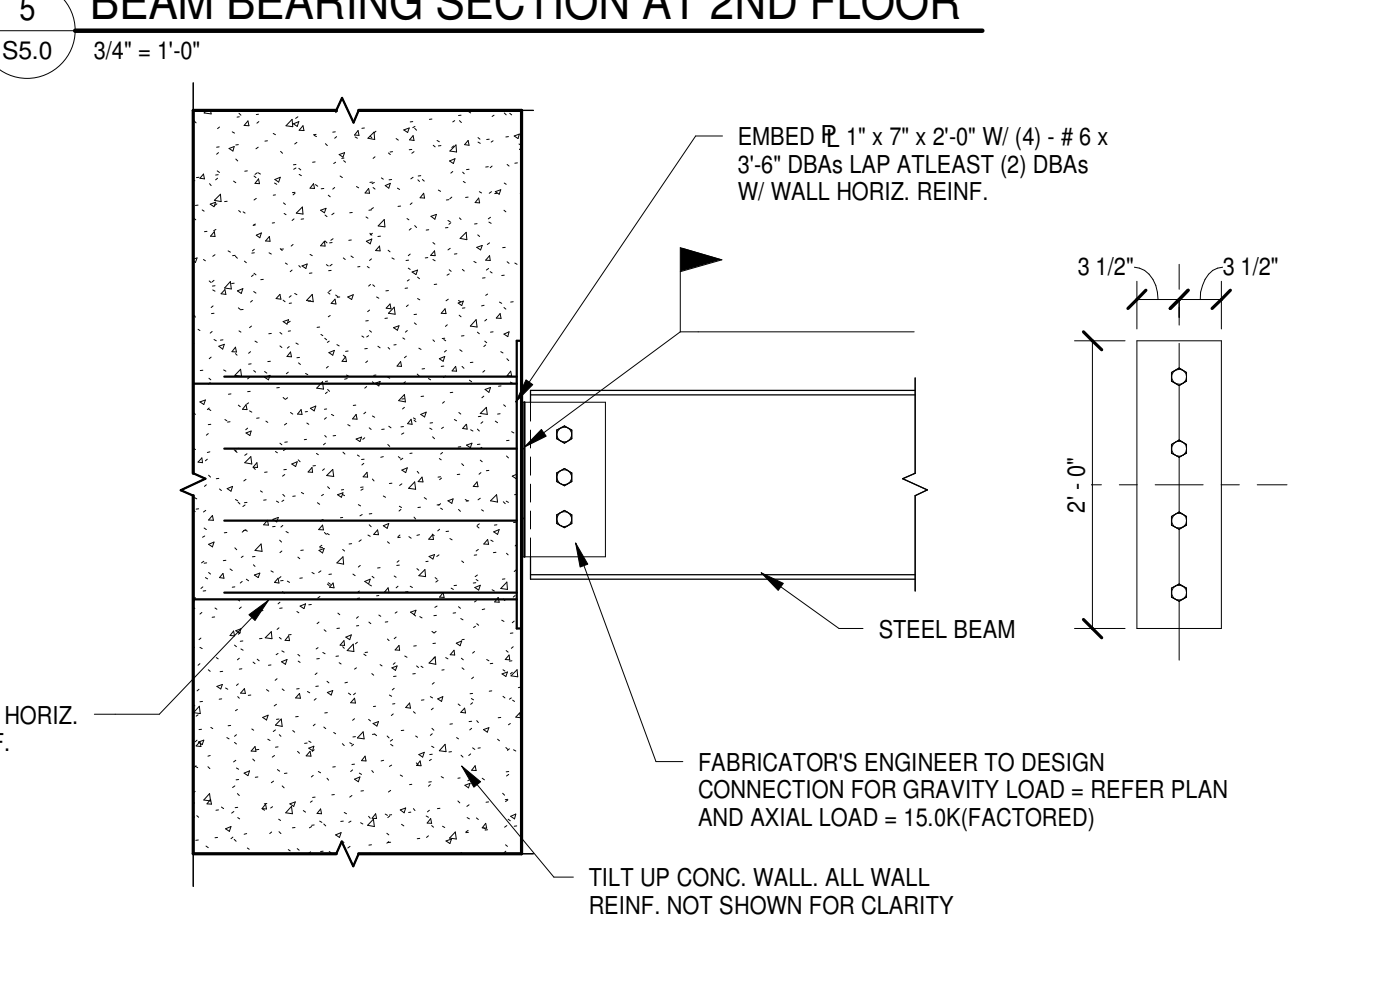


9 SECTION AT 2ND FLOOR  
S5.0 3/4" = 1'-0"

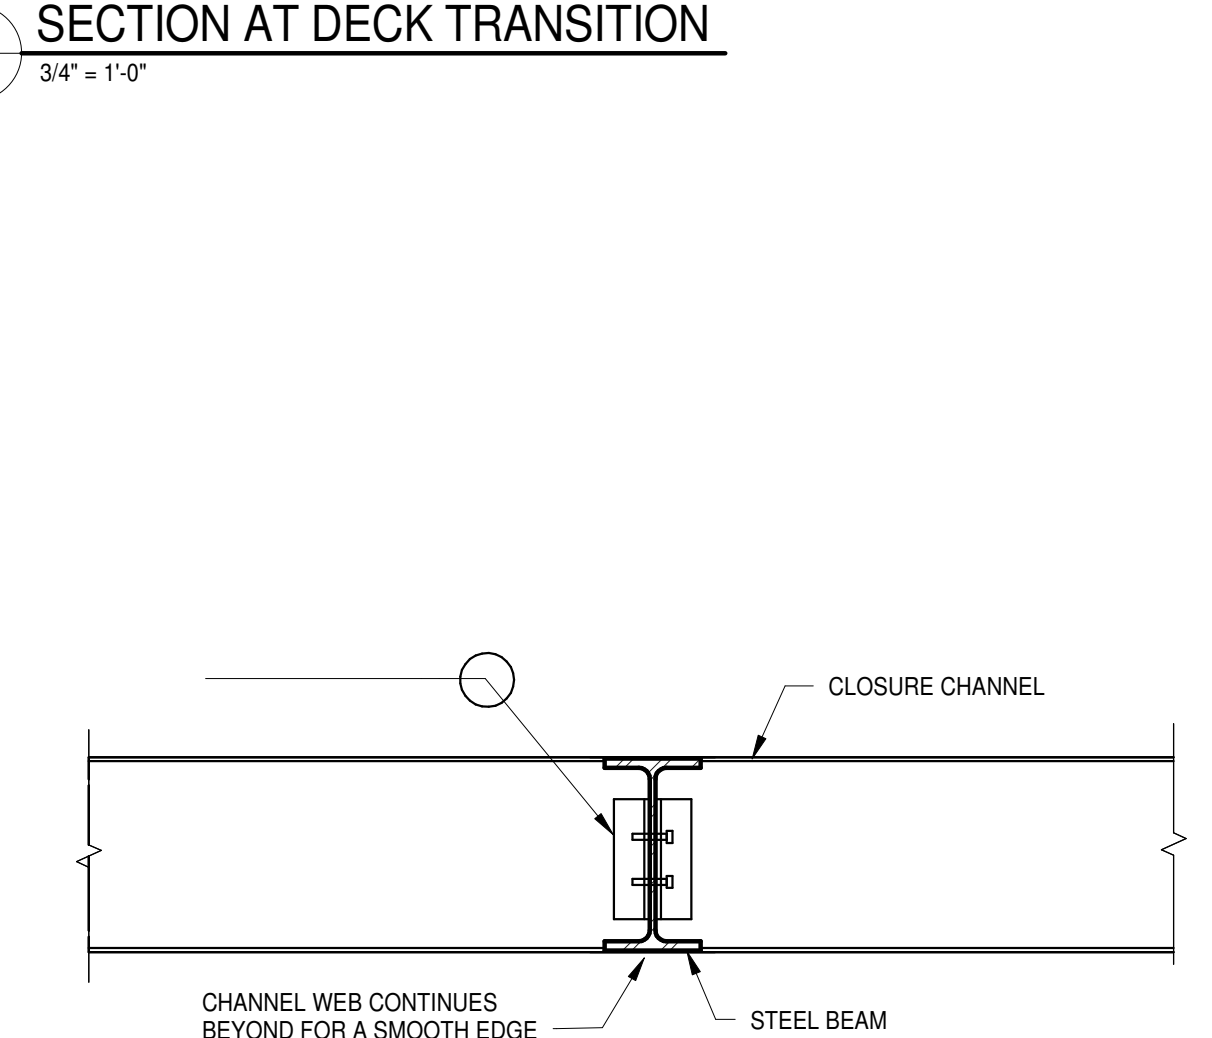


16 DETAIL  
S5.0 3/4" = 1'-0"

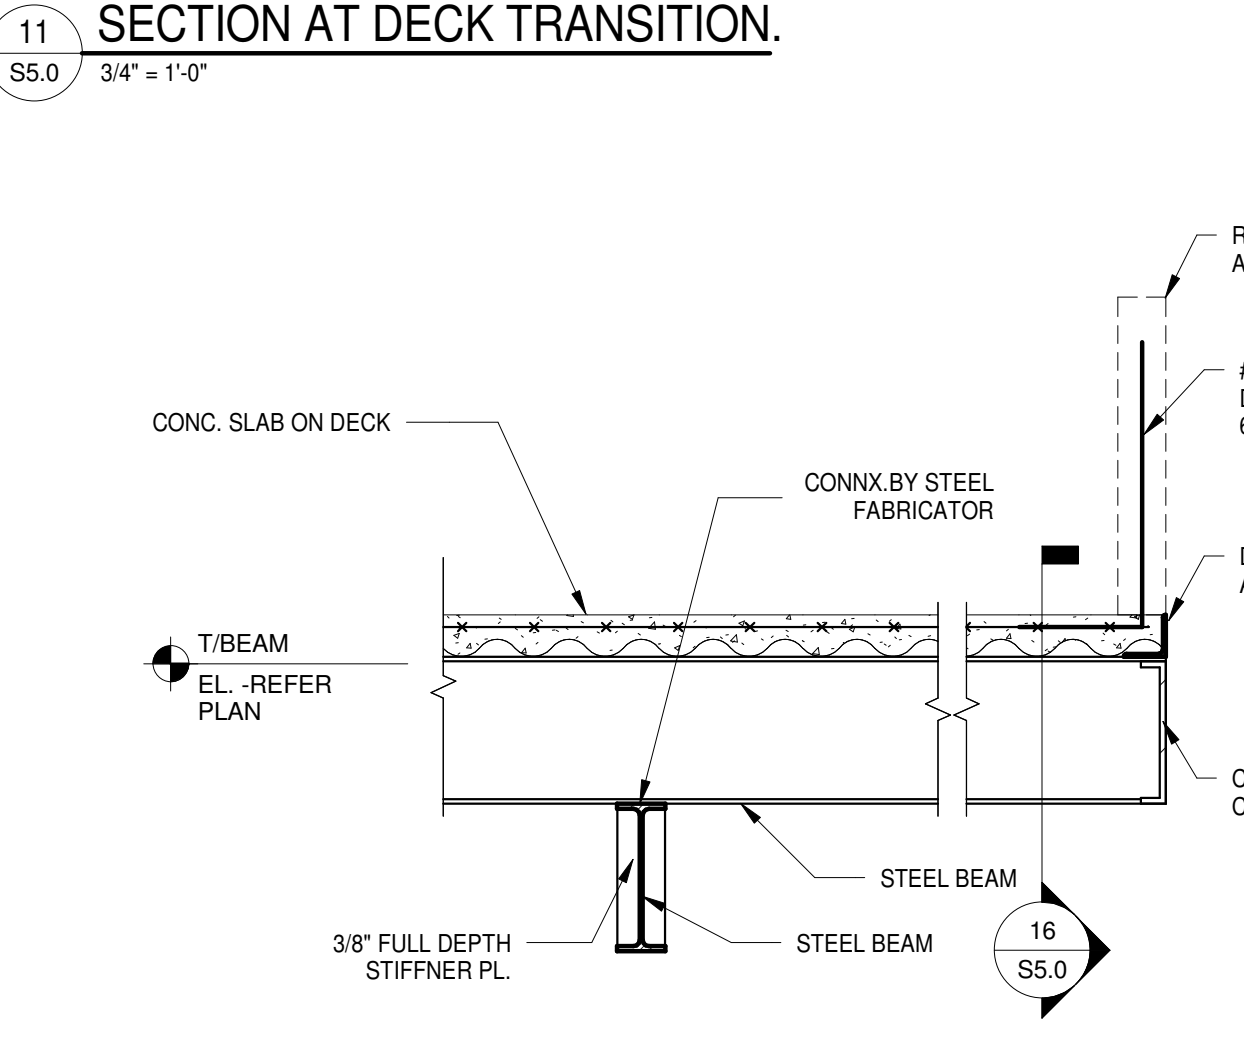


15 SECTION  
S5.0 3/4" = 1'-0"

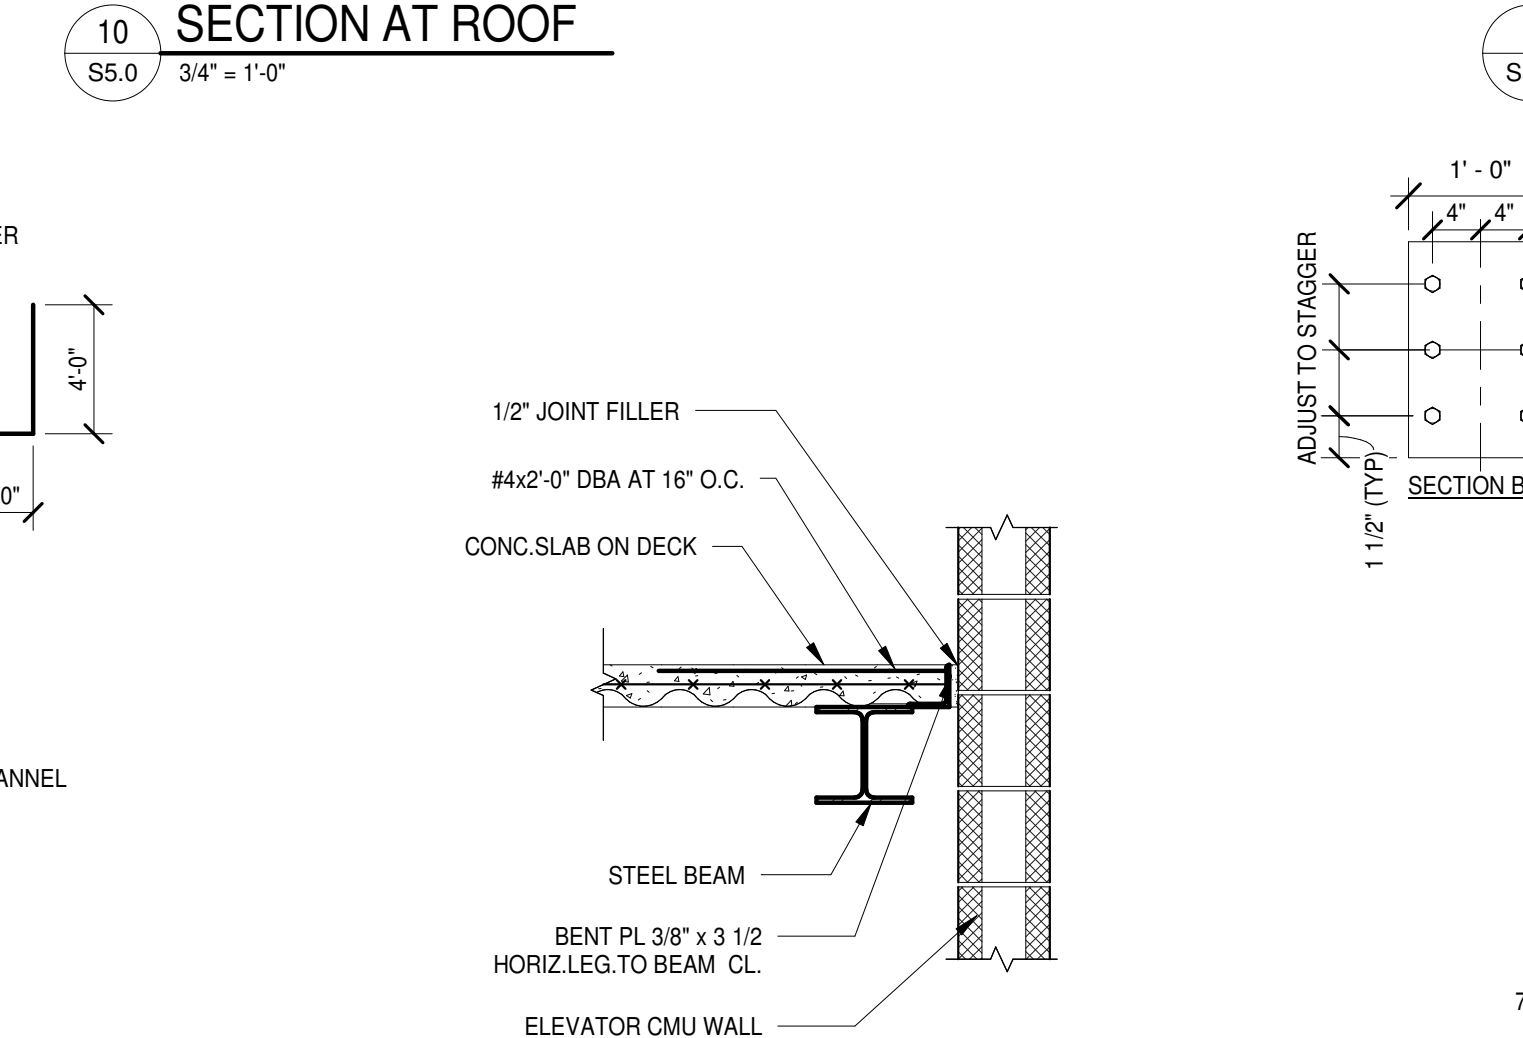

14 SECTION.  
S5.0 3/4" = 1'-0"

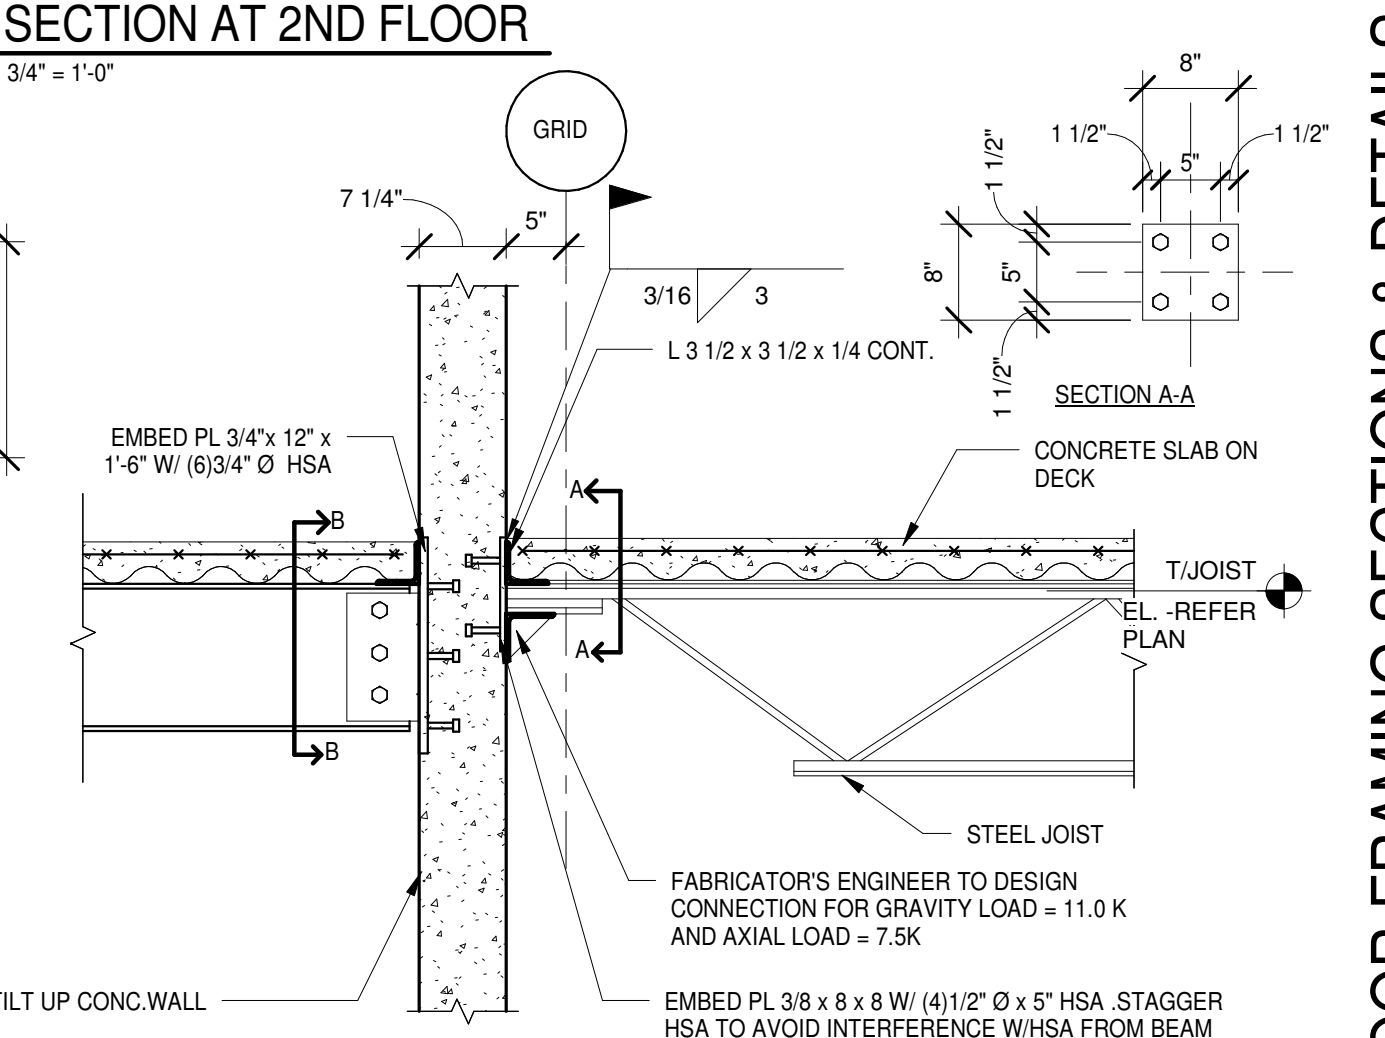

13 SECTION @ 2ND FLOOR.  
S5.0 3/4" = 1'-0"

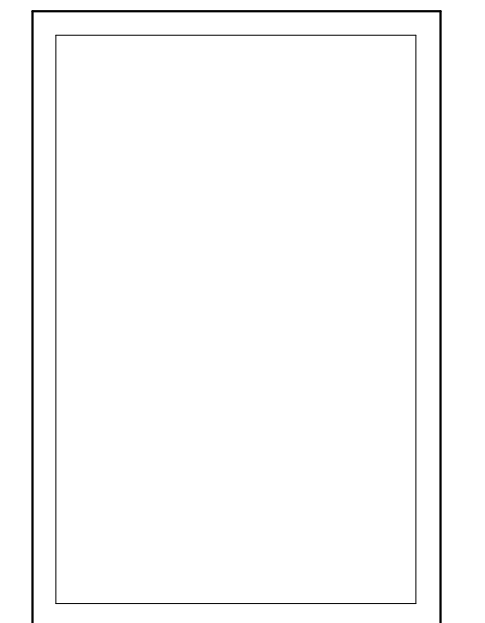


**RADHA KRISHNA TEMPLE**  
Owner  
ALLEN TEXAS

JOB NUMBER: 16DLS003  
ISSUE DATE: 04-22-2016  
DRAWN BY: SDB  
DESIGNED BY: NAV

REVISIONS

2	ADDENDUM NO. 2	06-09-2016
3	ADDENDUM NO. 3	08-25-2016

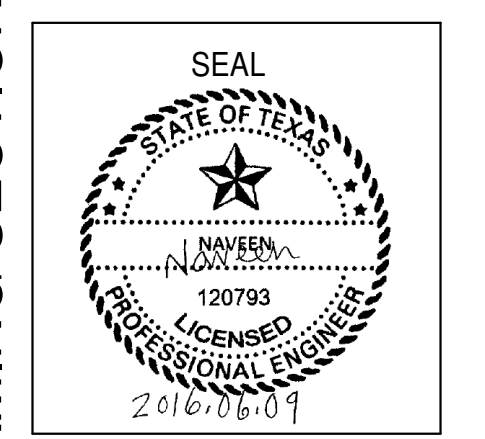

SHEET NUMBER  
**S5.0**

FLOOR FRAMING SECTIONS & DETAILS